

T ECHNICAL INFORMATION

Makita

NEW TOOL

Models No. ▶ DC9710

Description ▶ Charger

P 1 / 2

CONCEPTION AND MAIN APPLICATIONS


This charger can charge 1.3Ah Ni-Cd.batteries of 7.2V and 9.6V approx in 60 minutes.

Its brief benefits and features are as follows.

* The charging time is kept in the steady level by controlling the out put current (current for charging battery) in spite of the changeable input voltage (power source voltage).

The end of charging process is recognized by thermostat.

<Note> The Ni-Cd.batteries with high capacity (over 1.7Ah) and all of Ni-MH. batteries can not be charged with this charger.

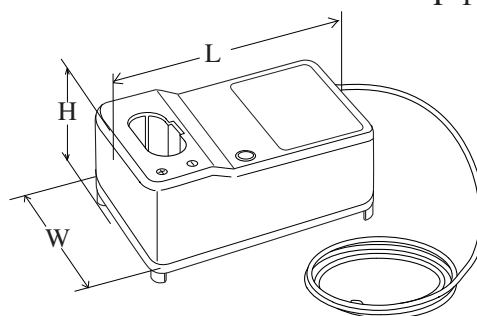

Dimensions : mm (")

Width (W)	80 (3-1/8)
Height (H)	63 (2-1/2)
Length (L)	145 (5-3/4)

► Specification

Voltage (V)	Current (A)	Cycle (Hz)	Continuous Rating (W)		Max. Output(W)
			Input	Output	
110 - 120	/	50 - 60	35		
220		50 - 60	35		
220 - 240		50 - 60	35		
230 - 240		50 - 60	35		


Output voltage (D/C)	7.2 V, 9.6 V,
Output current (D/C)	1.5 A
Charging time	Approx. 60 min.
Net weight : Kg (lbs)	0.41 (0.9)
Cord length : m (ft)	2.0 (6.6)

The chargeable batteries	
Voltage	Type No.
7.2 V	7000
9.6 V	9000
	9100
	9120

- <1> The circuit board can not be repaired, because the circuit itself are molded on the board with the urethane resin.
It has to be replaced completely with new one.
- <2> In case of damaged varistor or fuse, they can be repaired according to the following procedure without replacing the circuit board.


(1) How to find broken varistor

- In case that the surface of varistor (ref. to the following illustration) has broken or has become black, and fuse has been cut, the varistor has been damaged.
- Varistor can be damaged easily, if the charger is plugged in a double voltage of the rating one.
- It is considered that the varistor has been broken for other reasons, if the fuse is broken while the surface of varistor is not damaged. In this case circuit board has to be replaced.

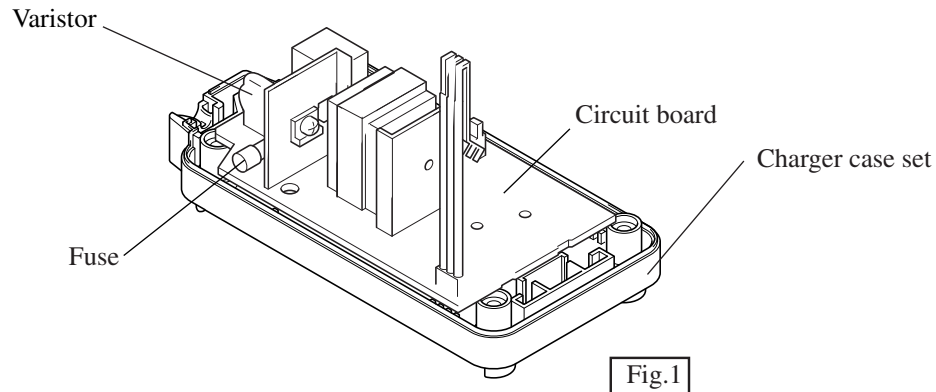


(2) Replacing damaged varistor

- Varistor is assembled on circuit board with solder. Remove it from circuit board with soldering iron.

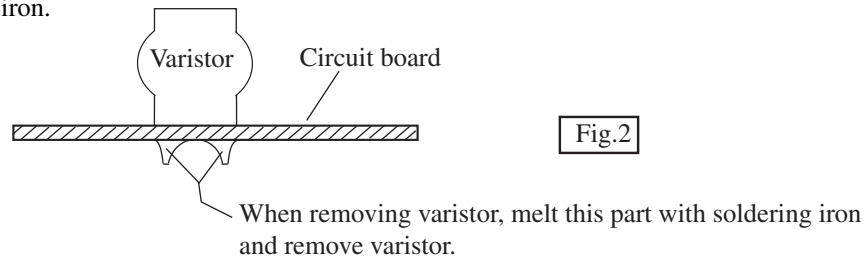

- Assemble new varistor to the circuit board by soldering.
- Cut the surplus of varistor's wire with nipper.

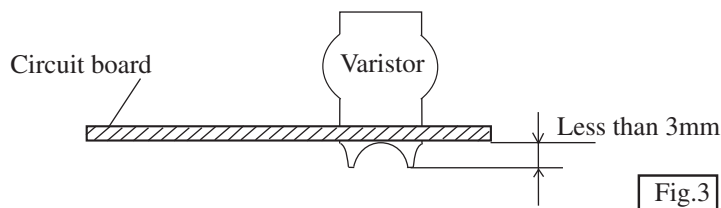

(3) Replacing damaged fuse

- Fuse is assembled on circuit board with solder. Remove it from circuit board with soldering iron.
- Assemble new fuse to the circuit board by soldering.
- Cut the surplus of fuse's wire with nipper.

