

T ECHNICAL INFORMATION



70783

(Page 1 of 2)


Subject ▶ Change of Strain Relief, Motor Housing, etc.

For Models ▶ 4157KB, 5057KB

Country ▶ See note below.

Description ▶ The following parts have been changed to increase assembling efficiency.

- 1) Pitch of Strain relief has been changed from 15 mm (9/16") to 20 mm (13/16").
Also, the pitch of Motor housing for securing a power supply cord has been changed, too.
These changes applies to the specified countries. See note below.
- 2) Indication plate and M4x8 pan head screw for all countries' specifications have been eliminated.
Instead, Angular guide has been modified as illustrated below.

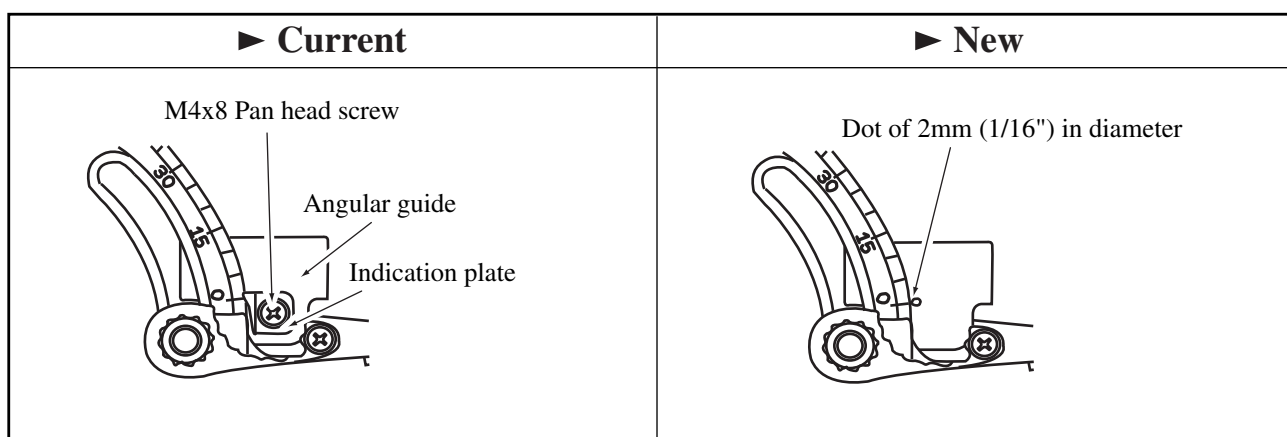

Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
010	Power Supply Cord 699013-2		1	No	Power Supply Cord 663846-1		1	4157KB for U.K. (110V) Interchangeable as a set
E01					Plug 655030-2		1	
E02					Non-insulated Terminal 654091-9		2	
011	Strain Relief 687001-1		1	No	Strain Relief 6870052-4		1	4157KB for U.K. (110V) Interchangeable as a set
006	Motor Housing Complete 152925-5		1	No	Motor Housing Complete 153921-6		1	
010	Power Supply Cord 699014-0		1	←	Power Supply Cord 665890-4		1	4157KB for Germany, Sweden
011	Strain Relief 687031-2		1	No	Strain Relief 687052-4		1	4157KB for Germany, Sweden Interchangeable as a set
006	Motor Housing Complete 152925-5		1	No	Motor Housing Complete 153921-6		1	
011	Strain Relief 687001-1		1	No	Strain Relief 687052-4		1	4157KB for Austria, France, Italy, Netherlands, Spain, Sweden, U.K.(240V), Algeria, Reunion, South Africa Interchangeable as a set
006	Motor Housing Complete 152925-5		1	No	Motor Housing Complete 153921-6		1	

Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
011	Strain Relief 687031-2		1	No	Strain Relief 687052-4		1	4157KB for Switzerland Interchangeable as a set
006	Motor Housing Complete 152925-5		1	No	Motor Housing Complete 153921-6		1	
010	Power Supply Cord 699015-8		1	←	Power Supply Cord 666226-0		1	5057KB for Saudi Arabia (220 V)
011	Strain Relief 687001-1		1	No	Strain Relief 687052-4		1	5057KB for Saudi Arabia (220 V) Interchangeable as a set
006	Motor Housing Complete 151554-1		1	No	Motor Housing Complete 153920-8		1	
010	Power Supply Cord 699015-8		1	No	Power Supply Cord 691025-1		1	5057KB for Philippines Interchangeable as a set
009	Cord Guard 682503-2		1	No	Cord Guard 682505-8		1	
011	Strain Relief 687001-1		1	No	Strain Relief 687053-2		1	5057KB for Philippines Interchangeable as a set
006	Motor Housing Complete 151554-1		1	No	Motor Housing Complete 153920-8		1	
011	Strain Relief 687001-1		1	No	Strain Relief 687063-9		1	5057KB for Canada, U.S.A. Interchangeable as a set
006	Motor Housing Complete 151554-1		1	No	Motor Housing Complete 153920-8		1	
011	Strain Relief 687000-3		1	No	Strain Relief 687053-2		1	5057KB for Australia, New Zealand Interchangeable as a set
006	Motor Housing Complete 151554-1		1	No	Motor Housing Complete 153920-8		1	
011	Strain Relief 687001-1		1	No	Strain Relief 687052-4		1	5057KB for New Caledonia Interchangeable as a set
006	Motor Housing Complete 151554-1		1	No	Motor Housing Complete 153920-8		1	
065	Indication Plate 344762-3		1	No				4157KB, 5057KB: For all countries Interchangeable as a set
067	Angular Guide 344763-1		1	No	Angular Guide 345491-1		1	
064	Pan Head Screw M4x8 911108-4		1	No				

Interchangeability mark ;

The arrow ← means that the new part can be substituted for the current.

Implementation

From May, 2004 production