



**Subject** ▶ Change on blade case and rubber ring

**For Models** ▶ 5903R and 5903

**Description** ▶ 1. Two holes will be made in the blade case. As shown in the figure below, the strain relief securing screws can be loosened by inserting a screwdriver through the holes in the blade case. It is not necessary to remove the blade case from the motor housing when removing the strain relief.

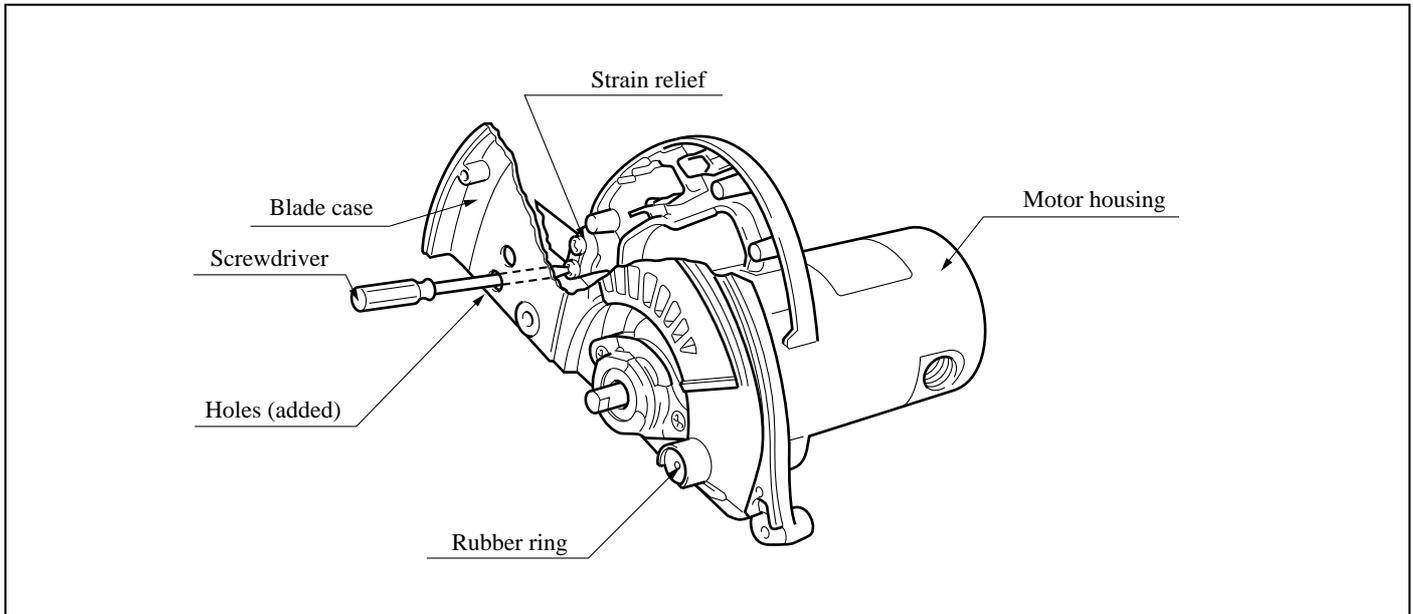

2. To increase the durability of the rubber ring which supports the safety cover (safety guard), the rubber ring 10 will be replaced by a rubber ring 8. An axis and protector (rib) for the rubber ring 8 will be added to the blade case. The pan head screw M8 (rubber ring securing screw) will be discontinued.

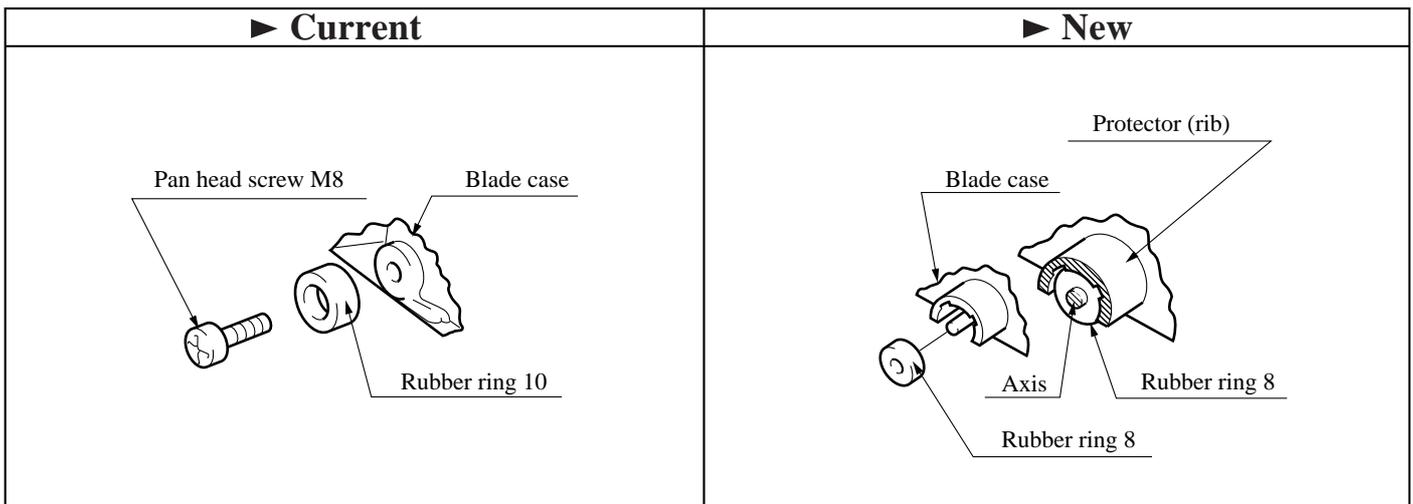

## Note

Install the rubber ring 8 so that its top surface is below that of the protector (rib).

## Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
44	Blade case complete 152452-2		1	No	Blade case complete 152495-4		1	No Interchangeable as a set
45	Rubber ring 10 262060-2		1	No	Rubber ring 8 262007-6		1	
46	Pan head screw M8 265032-6		1					

## Implementation

From May, 1995