

Subject

► Change on motor housing, rear cover, etc.

For Models


► 9218PB, 9218PBL (Polisher), 9218SB, 9215SB (Disc Sander)

Note

► This information does not apply to U.S.A and Canada.

Description

- 1. The rear cover will be molded into the motor housing. Consequently, the screw M4x20 will be discontinued.
- 2. The hole in the motor housing, through which the field lead wires run, will be changed to a square groove.
- 3. A rib will be added to the handle cover as shown in the figure below.

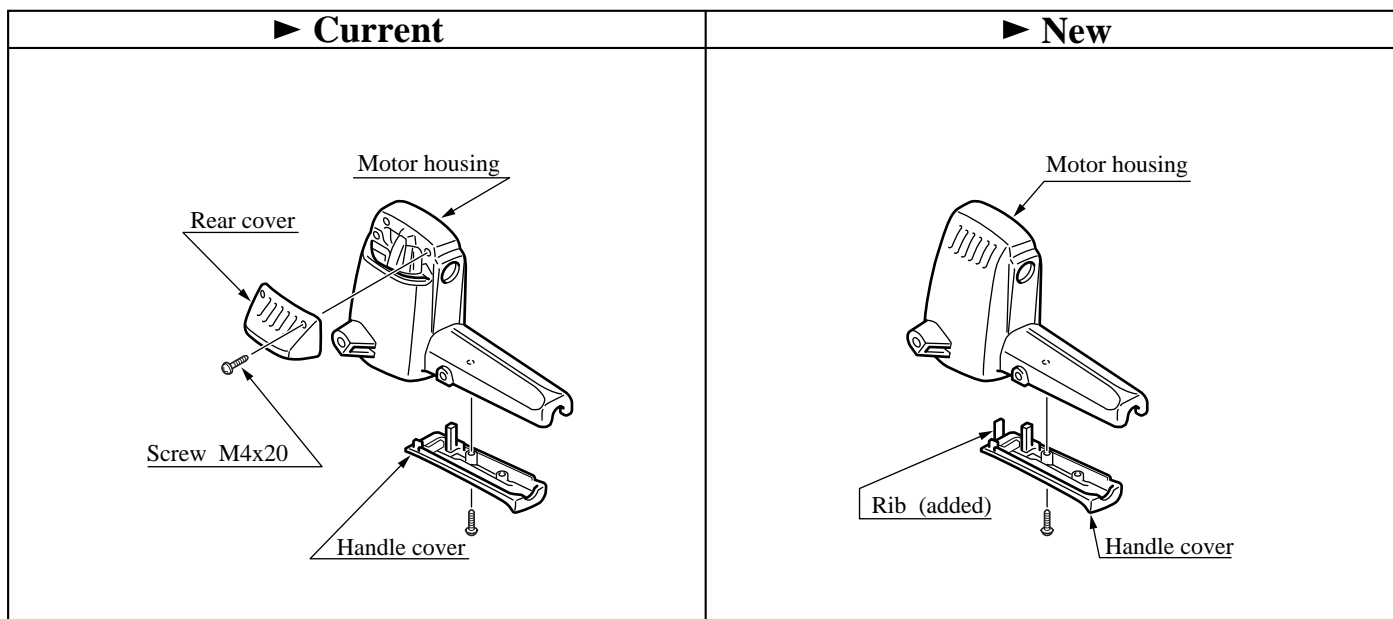

Interchangeability(I/C)

Item No.	Current part		Q'ty	New part		Q'ty	I/C	Note
31	Motor housing 156105-5		1	Motor housing 159596-9		1	No	Interchangeable as a set
28	Rear cover 411240-9		1					
27	Screw M4x20 911138-5		2					
41	Handle cover 411239-4		1	Handle cover 414994-7		1	No	

Note

The new type handle cover can fit into the current type motor housing if you remove the rib from the new type handle cover.

Enforcement schedule

9218PB : From serial No. 46137E
9218PBL : From serial No. 4045E
9218SB : From serial No. 84309E
9215SB : From serial No. 14325E