



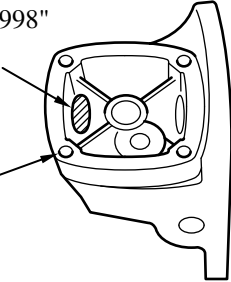

T ECHNICAL INFORMATION

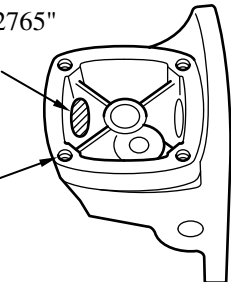

57816

- Subject** ▶ Changes on Gear Housing Complete and Screw
- For Models** ▶ 9520, 9520B, 9520NB, 9521NB, 9522NB
- Country** ▶ All countries
- Description** ▶ As illustrated below, Gear Housing Complete and Screw have been changed for quick repair.

	▶ Current	▶ New
Gear Housing Complete	<p>inscription of "3165998" for distinction</p>  <p>hole (untapped)</p>	<p>inscription of "3172765" for distinction</p>  <p>hole (tapped / M4)</p>
Screw (4pcs.)	 <p>Tapping Screw CT 4x16 (266034-5)</p>	 <p>with a spring washer</p> <p>Pan Head Screw M4x14 (911121-2)</p>

Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
016	Gear Housing Complete 159711-5		1	No	Gear Housing Complete 151742-0		1	Interchangeable as a set
021	Tapping Screw CT 4x16 266034-5		4	←	Pan Head Screw M4x14 911121-2		4	

Note

- Interchangeability mark ; ← means that the new part can be substituted for the current.
- Pan Head Screws (the New Part) CAN be used for repairing the machine having Tapping Screws (the Current Part), however,
CANNOT be used for unused Current Gear Housing Complete which does not have tapped holes.

Implementation

- 9520 : From your next order on/after Apr.,1999
- 9520B : From serial No.35214E (Apr.,1999)
- 9520NB : From serial No.29461E (May,1999)
- 9521NB : From serial No.74958E (Apr.,1999)
- 9522NB : From serial No.58802E (Apr.,1999)