


T ECHNICAL INFORMATION



96203
May 2012

- Subject** ➤ Addition of Caution label on Shaft pipe complete
- For Models** ➤ Makita : BBC300L, BC300LD
DOLMAR: AT-3630, AT3631
- Country** ➤ All countries
- Description** ➤ Caution label has been added on Shaft pipe complete to comply with the EU standards.

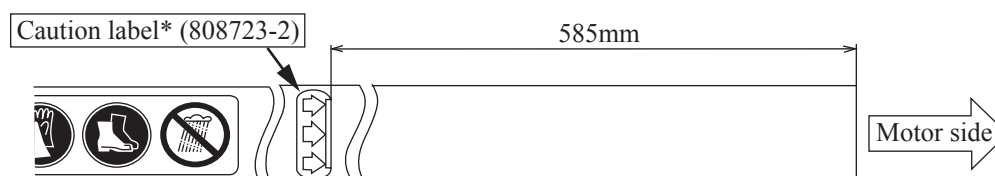

* Loop handle / Barrier bar must not be at the low position over the arrow marks because the revision of ISO11806 regulates the certain distance between Blade and Loop handle/ Barrier bar.

	Countries
①	All countries except the countries below ②, ③, ④, ⑤.
②	France, Germany, Italy, Netherlands, Reunion, Spain
③	Mexico
④	Canada, USA
⑤	Canada, Panama, USA
⑥	All countries

Note: When using the current shaft pipe complete 141095-5 and 141096-3 for the repair of the model manufactured on or after May 2012, attach Caution label 808723-2 as drawn above so that Loop handle/ Barrier bar can be assembled to the proper position on the shaft pipe complete.

Interchangeability(I/C)

	Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
①	031	Shaft pipe complete 141091-3		1	←	Shaft pipe complete 141889-8		1	BBC300L, BC300LD
②	031	Shaft pipe complete 141097-1		1	←	Shaft pipe complete 141890-3		1	AT-3630, AT-3631
③	031	Shaft pipe complete 141092-1		1	←	Shaft pipe complete 141891-1		1	BC300LD
④	031	Shaft pipe complete 141095-5		1	←	Shaft pipe complete 141095-5		1	BBC300L
⑤	031	Shaft pipe complete 141096-3		1	←	Shaft pipe complete 141096-3		1	BC300LD
⑥	---					Caution label 808723-2		1	The component of ①, ②, ③, ④, ⑤.

Interchangeability mark;

The arrow ← means that the new part can be substituted for the current.

Implementation

From May 2012 production