



**Subject** ▶ Change on motor housing

**For Models** ▶ JR3020 and 8406C

**Description** ▶ 1. The ribs of the motor housing will be changed from 2 mm (3/32") to 5 mm (3/16") in width.

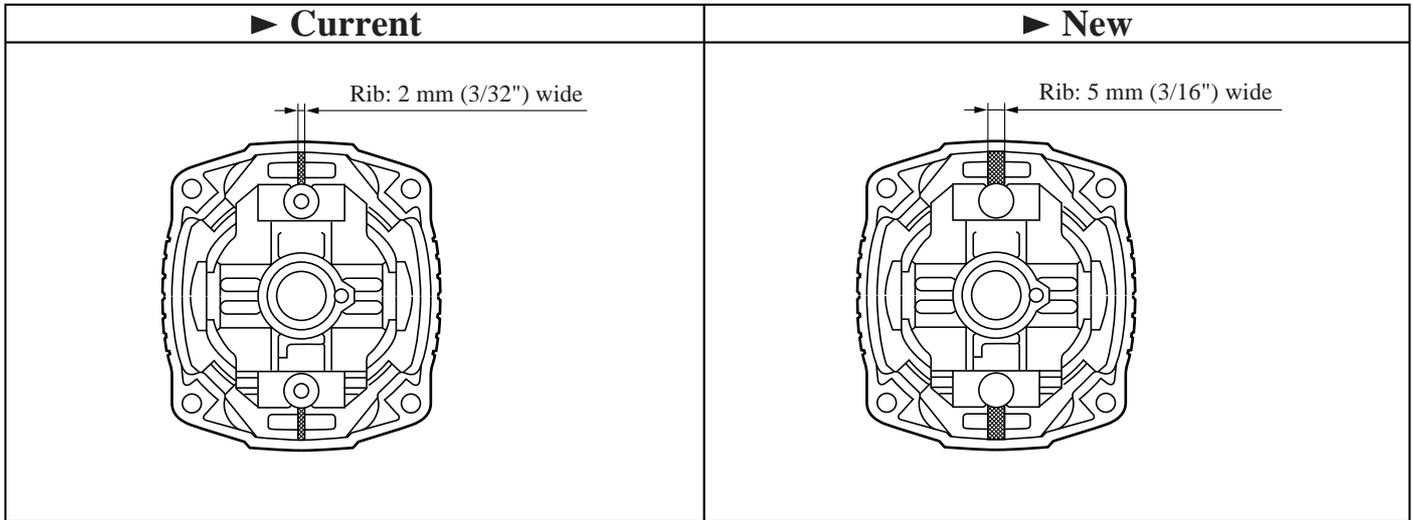

- 2. The field screws will be changed from pan head screws M5x65 to tapping screws PT5x65.
- 3. For 8406C only  
The pan head screw M4x16 which secures the pickup coil will be changed to a tapping screw PT 4x18.

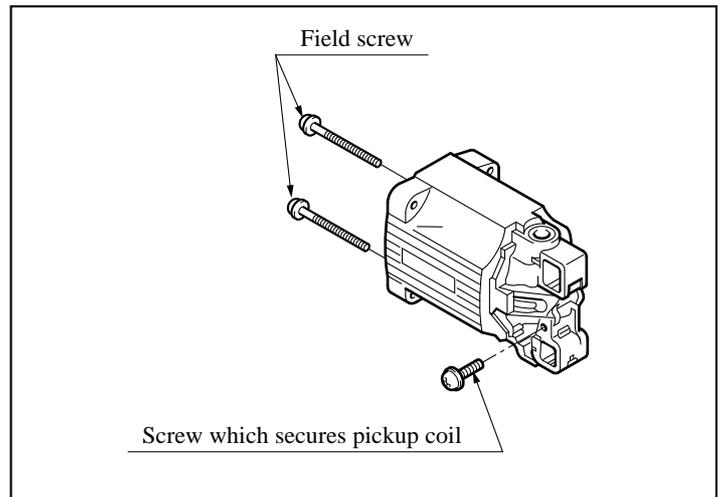

### Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
061	Motor housing complete 159546-4		1	No	Motor housing complete 159840-4		1	Interchangeable as a set (for 8406C, all three items; for JR3020, the above two items only)
067	Pan head screw M5x65 911686-4		2	No	Tapping screw PT5x65 266029-8		2	
	Pan head screw M4x16 911129-6		1	No	Tapping screw PT4x18 265995-6		1	

### Implementation

JR3020: From serial No. 13938E  
8406C : From the next order