


**Subject** ▶ Change on pin 6 and screw M5x40

**For Models** ▶ 3612BR, 3612B, 3612BRA, 3600NB, 3600NBR (Router) and 9300 (Bench Grinder)

**Description** ▶ 1. A cap 11 will be added to the pin 6 (for shaft lock).

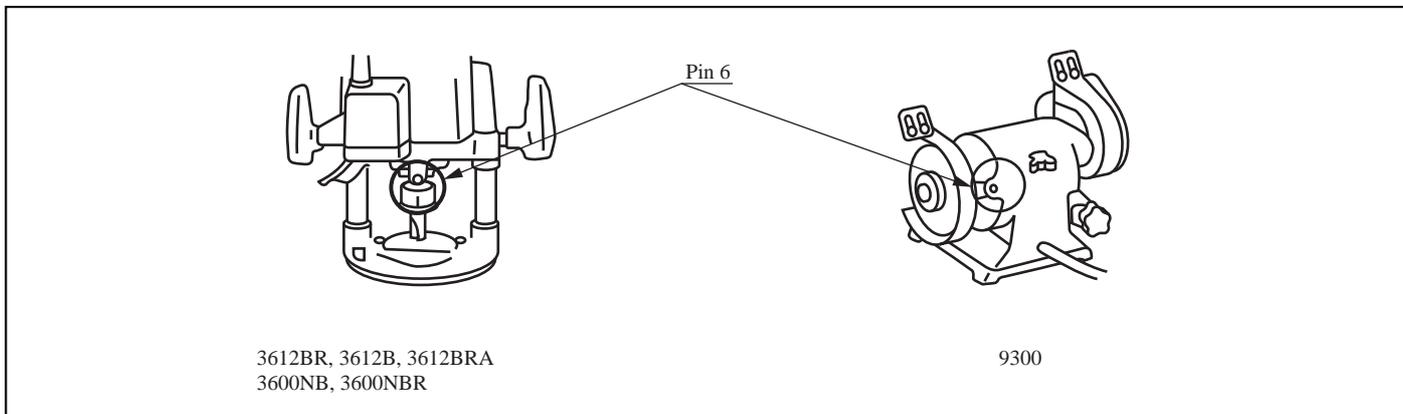

▶ Current	▶ New
<p>Pin 6</p>	<p>Cap 11 (added)</p>

2. For 3612BR, 3612B, 3612BRA, 3600NB and 3600NBR only  
The screws M5x40 which secure the motor bracket will be changed as follows.

Current: Screw M5x40 with spring washer

New : Screw M5x40 with spring washer and flat washer

### Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
67					Cap 11 286235-9		1	
25	Pin 6 256606-4		1	Yes	Pin 6 256606-4		1	
14	Screw M5x40 911261-6		4	Yes	Screw M5x40 911263-2		4	For 3612BR, 3612B, 3612BRA, 3600NB, 3600NBR

### Note

When you attach the cap 11 to the current type pin 6, always use adhesive (Three Bond 1521, etc.).

### Implementation

3612BR: From serial No. 198766E  
3612BRA: From serial No. 7130E  
3600NB: From serial No. 17379E  
3600NBR: From serial No. 6653E  
9300 : From serial No. 35902E