

**Subject** ► Changes on Fan110, Fan Housing Complete and Fan Cover


**For Models** ► 4014N and 4014NV(Blowers)

**Description** ► As described and illustrated below;

## 1.Fan 110

(1) The vent holes in the fan 110 have been changed in shape as illustrated below.


(2) Ribs have been added for reinforcement.

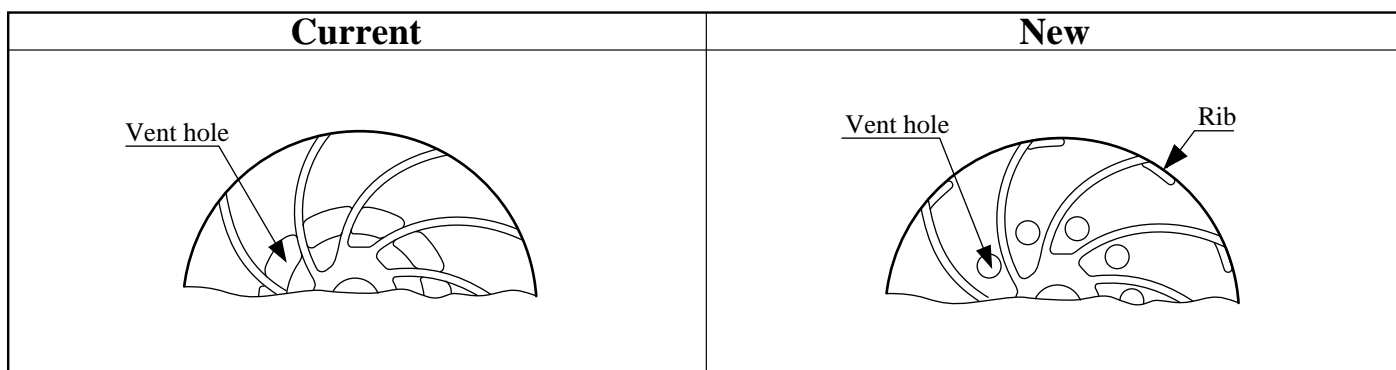


## Note

As a temporary step, the fan 110 illustrated on the right has been used from May to Oct., 1995.

Fully changed (new type) fan 110 has been used from Nov., 1995.

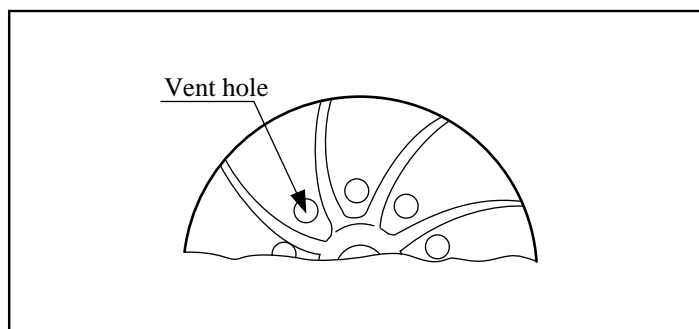

## 2.Fan housing complete and fan cover

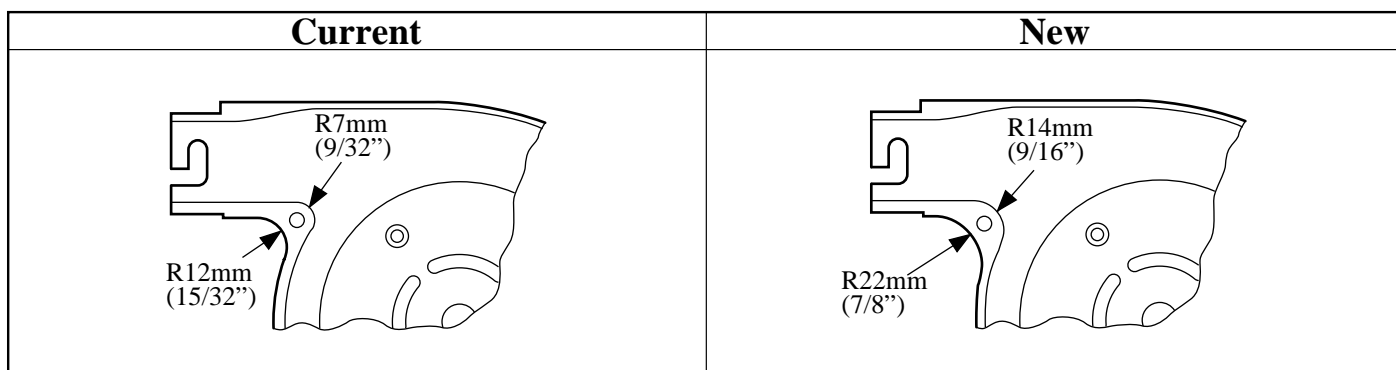

## Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
	Fan 110 241807-7		1	No	Fan 110 241888-1		1	Interchangeable as a set
	Fan housing complete 157464-0		1	No	Fan housing complete 159855-1		1	
	Fan cover 410482-2		1	No	Fan cover 415921-7		1	

## Implementation

- 1.Fan 110
  - 4014N : From serial No.199350E
  - 4014NV : From serial No.36683E
- 2.Fan housing
  - 4014N : From serial No.204362E
  - 4014NV : From serial No.38812E

## Correction

This is a revised version of TEC-111/95.

- (1) The material of fan 110 ;
  - TEC-111/95 : Changed from polycarbonate to polyamide.
  - TEC-111/95(R) : Remains unchanged.
- (2) Full change of fan 110 ;
  - TEC-111/95 : From Sept.,1995
  - TEC-111/95(R) : From Nov.,1995