

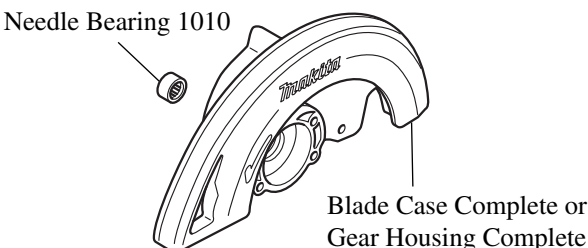

TECHNICAL INFORMATION



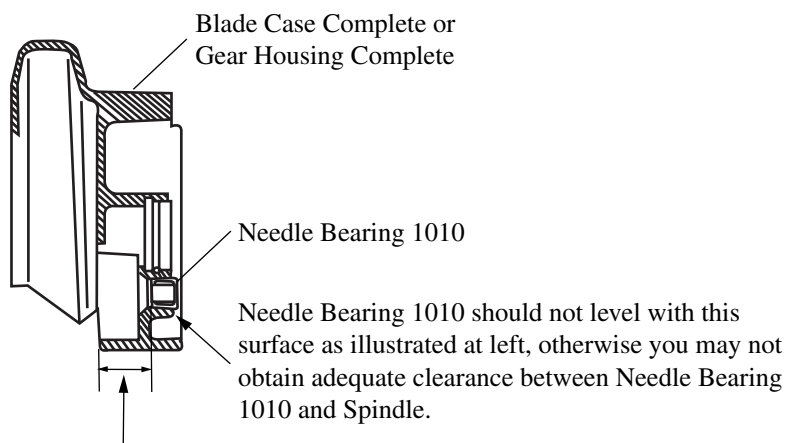
64123
(Page 1 of 2)

Subject	▶ Addition of Needle Bearing to Blade Case Complete or Gear Housing Complete
For Models	▶ 4157KB, 5007B, 5007NB, 5007NBA, 5007NH, 5007NL, 5007S, 5008B, 5008NB, 5008NBA, 5057KB, M513
Country	▶ All countries
Description	▶ See below.

Needle Bearing 1010 has been assembled into Blade Case Complete or Gear Housing Complete.

▶ Current	▶ New
 <p>Needle Bearing 1010 is not pre-installed.</p>	 <p>Needle Bearing 1010 is pre-installed.</p>

When replacing Needle Bearing 1010 itself, install it on the Blade Case Complete or Gear Housing Complete as illustrated below.



Distance must be 22.3-22.7mm.

Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
See note 1 below.	Blade Case Complete 152753-8		1	No	Blade Case Complete 153304-0		1	See note 2 below.
	Needle Bearing 1010 212052-1		1					
	Blade Case Complete 151803-6		1	No	Blade Case Complete 153303-2		1	See note 3 below.
	Needle Bearing 1010 212052-1		1					

Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
See note 1 below.	Blade Case Complete 154321-3		1	No	Blade Case Complete 153316-3		1	See note 4 below.
	Needle Bearing 1010 212052-1		1					
	Blade Case Complete 154322-1		1	No	Blade Case Complete 153305-8		1	See note 5 below.
	Needle Bearing 1010 212052-1		1					
	Blade Case Complete 152628-1		1	No	Blade Case Complete 153307-4		1	See note 6 below.
	Needle Bearing 1010 212052-1		1					
	Blade Case Complete 152630-4		1	No	Blade Case Complete 153306-6		1	See note 7 below.
	Needle Bearing 1010 212052-1		1					
	Gear Housing Complete 152926-3		1	No	Gear Housing Complete 153302-4		1	See note 8 below.
	Needle Bearing 1010 212052-1		1					

Note

1. Item No. for Blade Case Complete or Gear Housing Complete

Model	4157KB	5007B	5007NB	5007NBA	5007NH	5007NL	5007S	5008B	5008NB	5008NBA	5057KB	M513
Item No.	033	032	033	033	034	034	032	034	034	034	033	032

Item No. for Needle Bearing 1010

Model	4157KB	5007B	5007NB	5007NBA	5007NH	5007NL	5007S	5008B	5008NB	5008NBA	5057KB	M513
Item No.	035	042	042	042	016	016	042	018	018	018	035	042

- For 5007B, 5007NB, 5007S, M513 manufactured in MJ (Makita Japan) and 5007NB, 5007NBA manufactured in MCC (Makita (China) Co., Ltd.)
- For 5007NB, 5007NBA manufactured in MCT (Makita Canada, Inc.)
- For 5007NB, 5007NBA manufactured in MCA (Makita Corporation of America)
- For 5008B, 5008NB manufactured in MJ (Makita Japan) and 5008NB, 5008NBA manufactured in MCT (Makita Canada, Inc.)
- For 5007NH manufactured in MCA (Makita Corporation of America)
- For 5007NL manufactured in MCA (Makita Corporation of America)
- For 4157KB, 5057KB manufactured in MCA (Makita Corporation of America)

Implementation

Machines manufactured in MJ (Makita Japan)

5007B : Discontinued since Oct., 1993
 5007NB: From serial No. 1383260E (Oct., 2001)
 5007S : From serial No. 2001E (Aug., 2001)
 5008B : From serial No. 119873E (Aug., 2001)
 5008NB: Discontinued since Oct., 1993
 M513 : Discontinued since June, 1991

Machines manufactured in MCA (Makita Corporation of America)

To be informed later

Machines manufactured in MCC (Makita (China) Co., Ltd)

To be informed later

Machines manufactured in MCT (Makita Canada, Inc.)

To be informed later