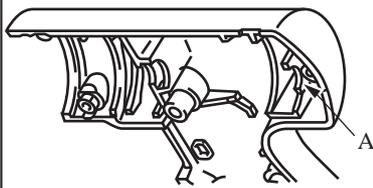
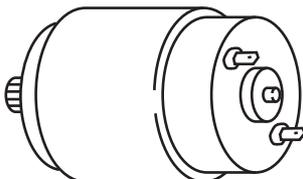
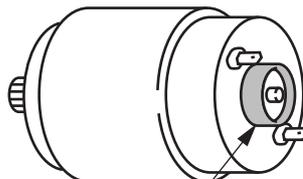


- Subject** ▶ Changes on housing and DC motor
- For Models** ▶ 6220D,6221D(Cordless Driver Drills)
- Description** ▶ As illustrated below, two parts have been changed.

		▶ Current	▶ New
Housing R,L	Diameter of rib holding DC motor  	A: $\phi 10.2$	A: $\phi 13.0$
DC motor			 Sleeve 10 Sleeve 10 (P.N.689056-2) is added to the current DC motor.

### Note

Sleeve 10----- Inner Diameter:  $\phi 10.2$ , Outer Diameter: $\phi 13.0$ , Height:5.0

In case of using the new DC motor to the current housing, remove Sleeve 10. (with nipper, etc.)

In case of using the current DC motor to the new housing, add Sleeve 10 to the current motor with arbor press.

### Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
1	Housing Set 182664-3		1	No	Housing Set 182819-0		1	Interchangeable as a set
37	DC Motor 629671-0		1	No	DC Motor 629694-8		1	
37					Sleeve 10 689056-2		1	See note above

### Implementation

From Sep., 1995