

T ECHNICAL INFORMATION




64679

Subject ▶ Change of Tapping Screws, Gear Housing Complete

For Models ▶ 9015A, 9015B, 9015DB, 9016B, 9016DB

Country ▶ All countries

Description ▶ Tapping Screws Mx16 for securing Bearing Box to Gear Housing Complete have been replaced by Pan Head Screw M5x16. Accordingly, Gear Housing Complete has been changed as shown below.

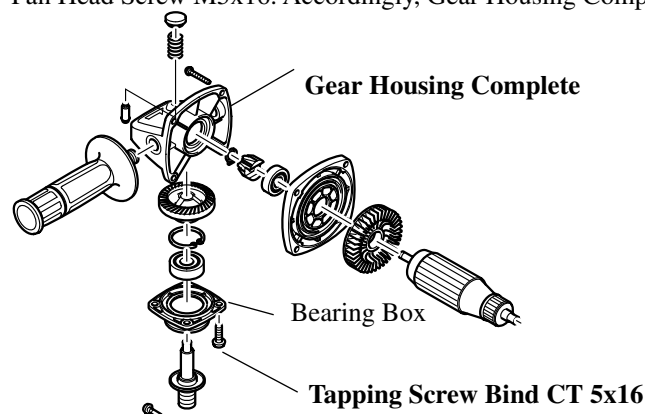

▶ Current	▶ New
Tapping Screw CT5x16 (266027-2) 	Pan Head Screw M5x16 (265096-0)
Gear Housing Complete (159995-5) Holes are not threaded inside.	Gear Housing Complete (153374-9) Holes are threaded inside.

Note: When re-fastening the current screws on the current Gear Housing Complete so as not to be loosened, apply adhesive (Lock Tite 242 50G, Part No. 0405065-5A) inside the holes on the current Gear Housing Complete. When replacing the current Gear Housing Complete with the unused current Gear Housing Complete, apply a bit of the above adhesive inside those holes only after making threaded holes by screwing the tapping screws in the holes.

Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
See below	Tapping Screw CT5x16 266027-2		4	No	Pan Head Screw M5x16 265096-0		4	Interchangeable as a set
004	Gear Housing Complete 159995-5		1	No	Gear Housing Complete 153374-9		1	

Item No. of Tapping Screw

Model	9015A	9015B	9015DB	9016B	9016DB
Item No.	020	019	019	019	019

Implementation

9015A: From serial No. 2126E (Oct., 2001)
9015B: From serial No. 110993E (Oct., 2001)
9015DB: From serial No. 23699E (Oct., 2001)
9016B: From serial No. 27315E (Oct., 2001)
9016DB: From serial No. 9210E (Oct., 2001)