


T ECHNICAL INFORMATION



64025
(page 1 of 2)

Subject	▶ Change on Motor Housing and Switch Knob in Shape
For Models	▶ 9560, 9560C, 9560CV, 9561, 9561C, 9561CV, 9562, 9562C, 9562CV, 9563, 9563C, 9563CV, 9564, 9564C, 9564CV, 9564CVL, 9565, 9565C, 9565CV, 9565CVL, BO6040, GD0800C, GD0810C
Country	▶ All countries
Description	▶ Motor Housing/Motor Housing Complete and Switch Knob have been changed in shape to improve the durability as shown below.

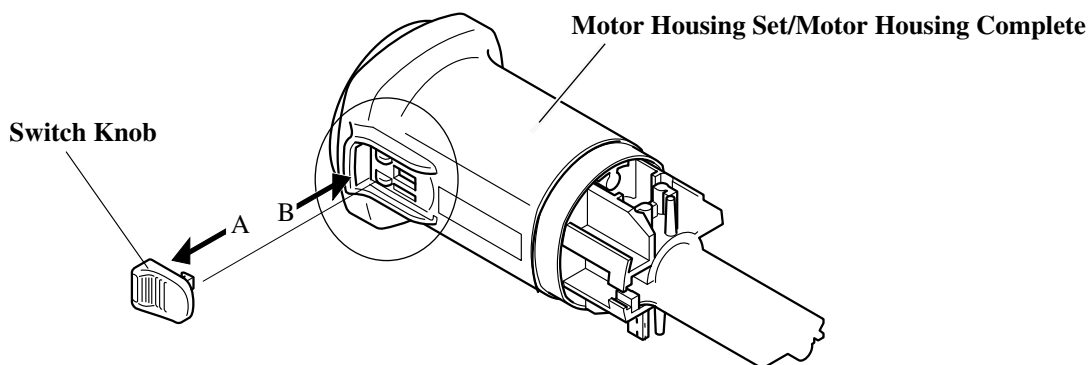

	▶ Current	▶ New
Switch Knob (view from A)	<p>2.0 mm</p> <p>ribs</p>	<p>1.0 mm</p> <p>The width of the two ribs have been changed from 2.0 mm to 1.0 mm.</p>
Motor Housing (view of encircled portion from B)	<p>2.0 mm</p> <p>protruding ribs</p>	<p>4.0 mm</p> <p>The width of two protruding ribs have been changed from 2.0 mm to 4.0 mm.</p>

Interchangeability(I/C)

- GD0800C, GD0810C: For all countries except for U.S.A., Canada and Guam
BO6040, 9560, 9560C, 9560CV, 9561, 9561C, 9561CV, 9562, 9562C, 9562CV: For all countries

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
BO6040: 068 GD0800C: 056 GD0801C: 056 The remaining models: 033	Motor Housing 417184-1		1	No	Motor Housing Set 183406-8		1	See Notes 1 and 2 on next page.
BO6040: 066 GD0800C: 058 GD0801C: 058 The remaining models: 035	Switch Knob 417188-3		1	←	Switch Knob 417813-6		1	

Interchangeability(I/C)

- **9564CV, 9565CV: For all countries except for U.S.A., Canada and Guam**
9563, 9563C, 9563CV, 9564, 9564C, 9565, 9565C, 9565CVL: For all countries

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
033	Motor Housing 417182-5		1	No	Motor Housing Set 183407-6		1	See Notes 1 and 2 on next page.
035	Switch Knob 417188-3		1	←	Switch Knob 417813-6		1	

- **GD0800C: For U.S.A., Canada and Guam**

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
056	Motor Housing Complete 152865-7		1	No	Motor Housing Complete 153296-3		1	See Notes 1 and 2 on next page.
058	Switch Knob 417188-3		1	←	Switch Knob 417813-6		1	

- **GD0810C: For U.S.A., Canada and Guam**

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
056	Motor Housing Complete 152866-5		1	No	Motor Housing Complete 153297-1		1	See Notes 1 and 2 on next page.
058	Switch Knob 417188-3		1	←	Switch Knob 417813-6		1	

- **9564CV, 9565CV: For U.S.A., Canada and Guam**

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
033	Motor Housing Complete 152918-2		1	No	Motor Housing Complete 153294-7		1	See Notes 1 and 2 on next page.
035	Switch Knob 417188-3		1	←	Switch Knob 417813-6		1	

- **9564CVL For U.S.A., Canada and Guam**

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
033	Motor Housing Complete 152919-0		1	No	Motor Housing Complete 153295-5		1	See Notes 1 and 2 on next page.
035	Switch Knob 417188-3		1	←	Switch Knob 417813-6		1	

Interchangeability mark ;

The arrow ← means that the new part can be substituted for the current.

Note

- 1) Makita logo label is put on the Motor Housing Sets (Part Nos. 183406-8 and 183407-6)
- 2) When replacing the current Motor Housing/ Motor Housing Complete with the new one, also replace the Switch Knob with the new one.

Implementation

9560: From serial No. 1013E (June, 2001)

9561: From serial No. 2065E

Month and year of implementation will be informed later.

9561C: From serial No. 1230E

Month and year of implementation will be informed later.

The remaining models to be informed later.