

**Subject** ▶ Change of Wheel Cover Ass'y, Bearing box, Motor Housing

**For Models** ▶ GA5010, GA5011, GA5020, GA5020C, GA5021, GA5021C, 9562CH, 9562CR, 9562CVH, 9562CVR, 9565CLR, 9565CR, 9565C, 9565CV, 9565CVL, 9565CVR, 9565H, 9565PC, 9565PCV

**Country** ▶ See pages 3 and 4.

**Description** ▶ Wheel cover ass'y, Bearing box and Motor housing have been changed to comply with the clause of IEC/ EN60745 EU mechanical directives.  
See Figs. 1 to 8.

Fig. 1

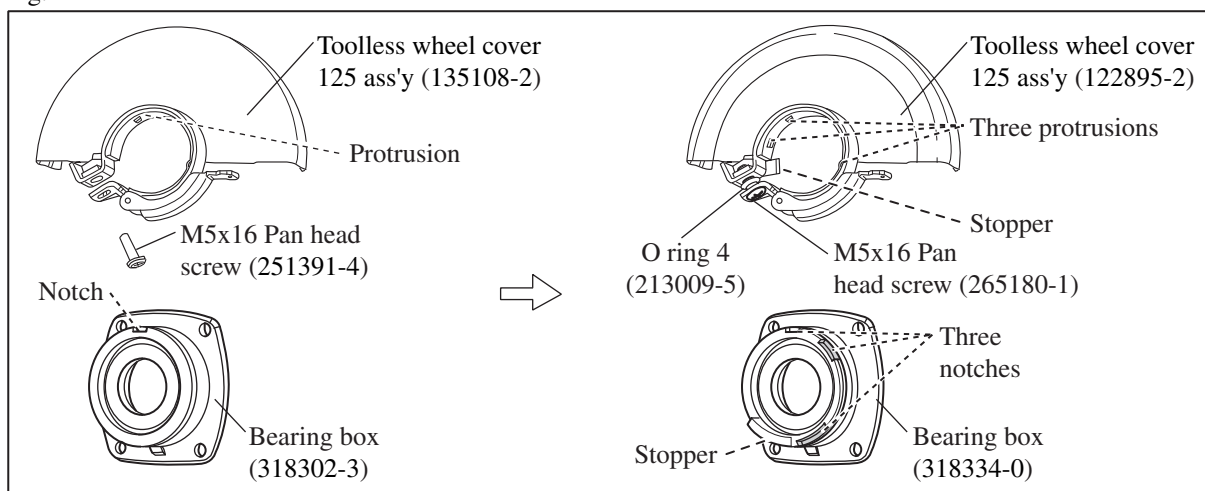


Fig. 2

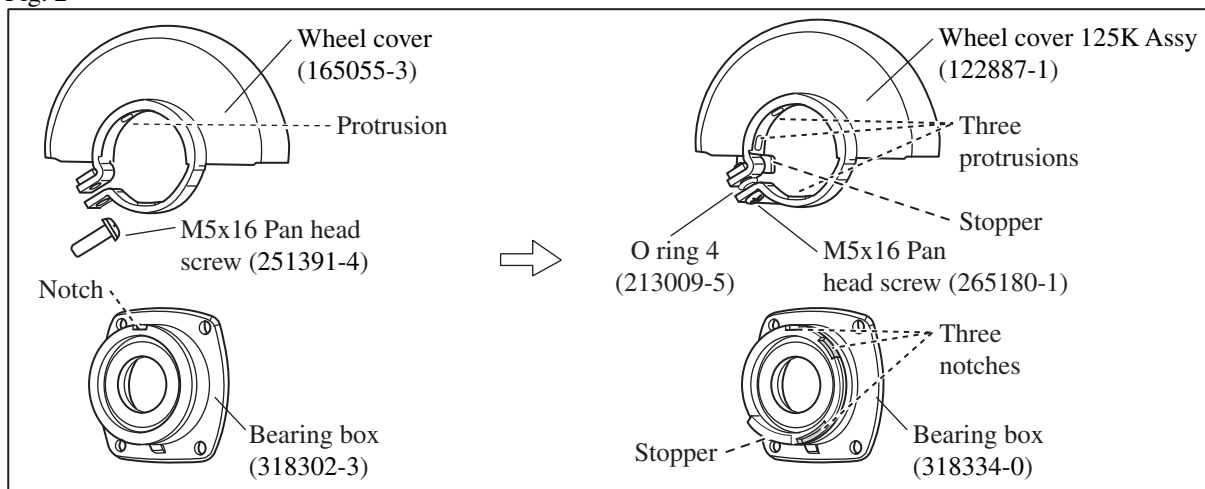


Fig. 3

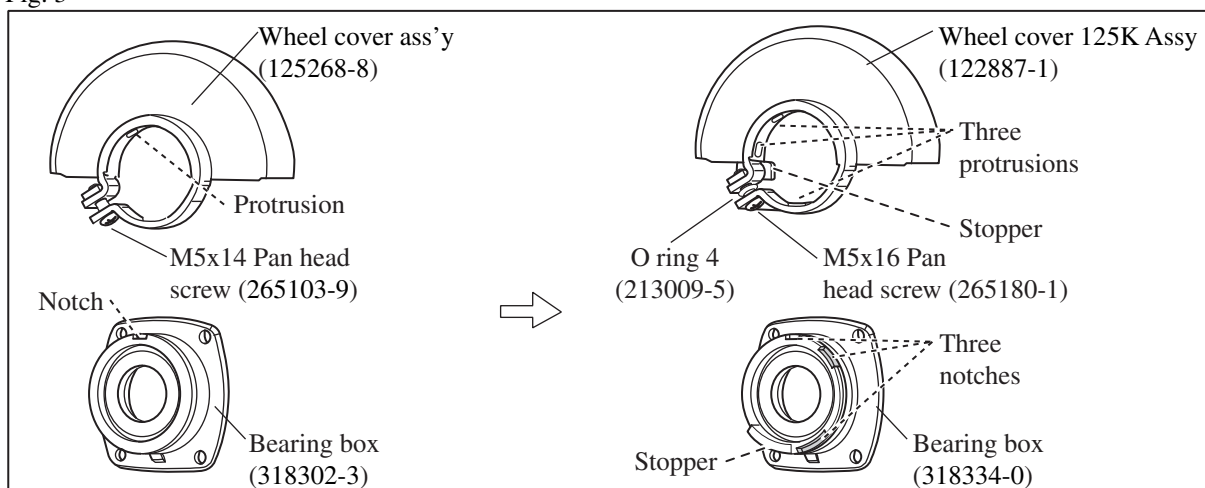


Fig. 4

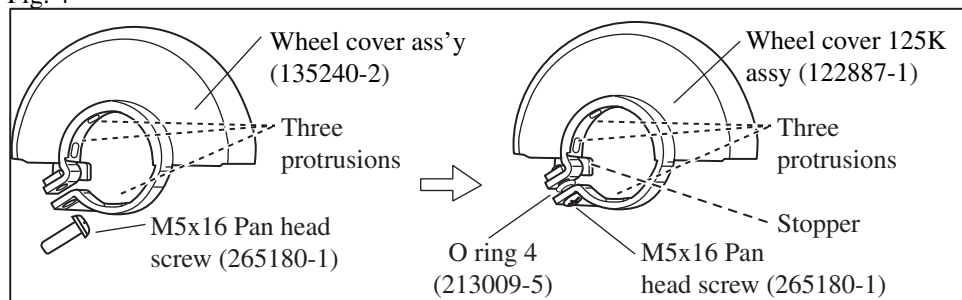


Fig. 5

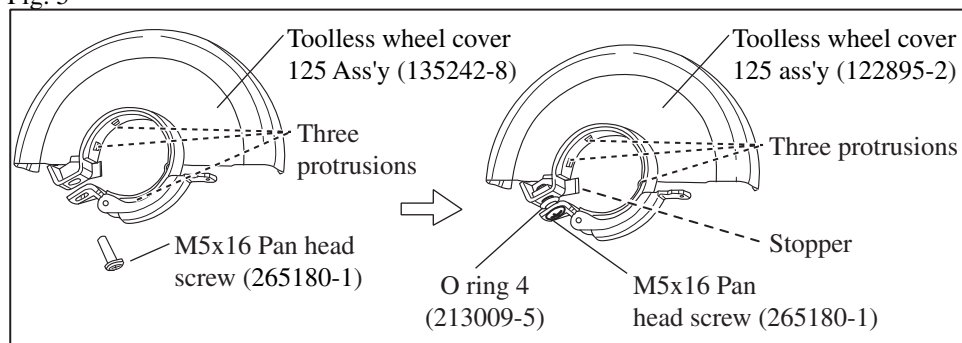


Fig. 6

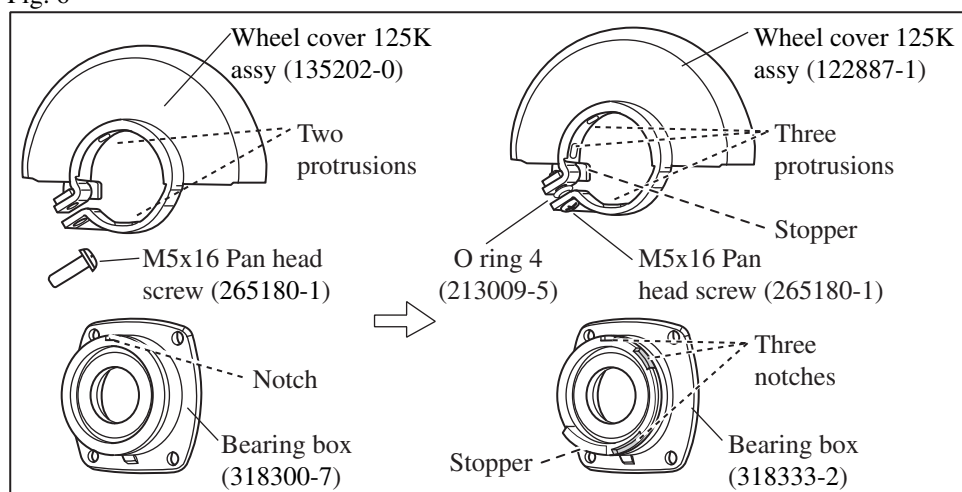


Fig. 8


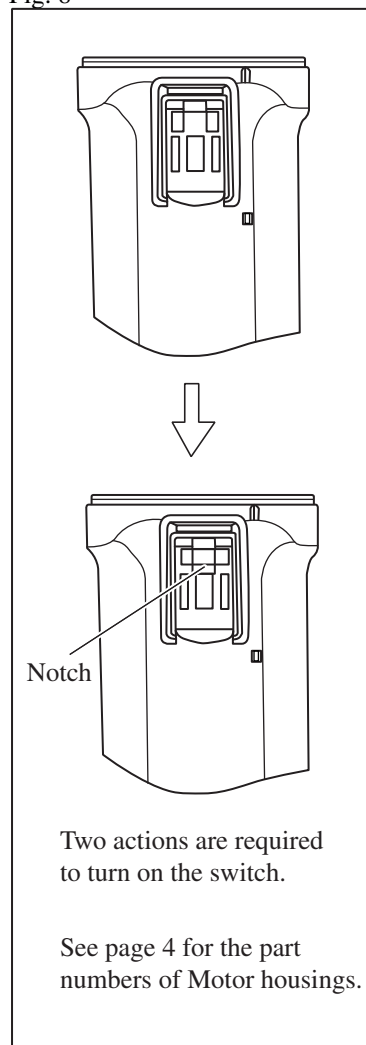


Fig. 7

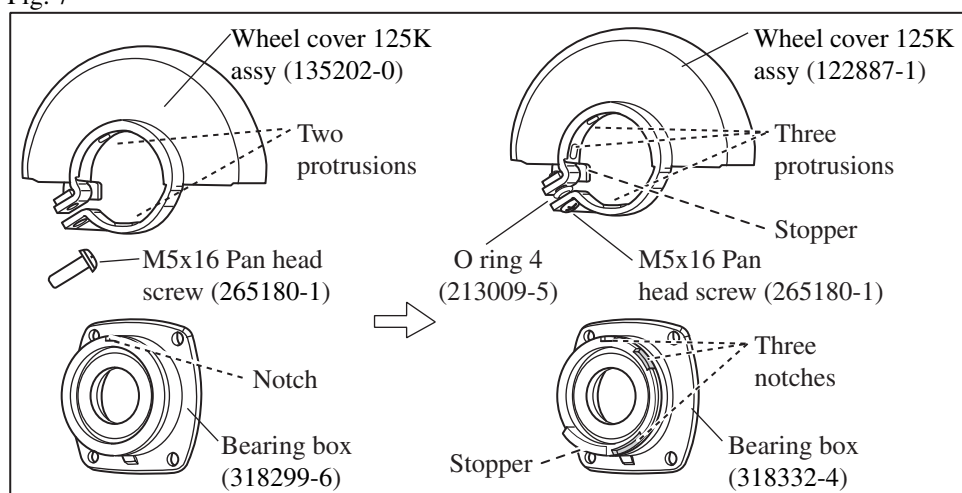

## Interchangeability(I/C)

	Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
See Fig.1.	048	Toolless Wheel Cover 125 Ass'y 135108-2		1	No	Toolless Wheel Cover 125 Ass'y 122895-2		1	The current remains available.
	—	—		—	—	O Ring 4 213009-5		1	↑ Component of 135108-2/122895-2
	049	Pan Head Screw M5x16 251391-4		1	←	Pan Head Screw M5x16 265180-1		1	↓
	9562CH, 9562CR, 9562CVH, 9562CVR, 9565CR, 9565CVR, 9565H: 053 9565C, 9565CV: 054	Bearing Box 318302-3		1	No	Bearing Box 318334-0		1	↑ <b>9562CH for</b> Austria, France, Germany, Italy, Netherlands, Poland, Reunion, Russia, Spain, Sweden, Switzerland, UK <b>9562CR for</b> Austria, France, Germany, Netherlands, Reunion, Spain <b>9562CVH for</b> Austria, France, Germany, Italy, Netherlands, New Caledonia, Poland, Reunion, Russia, Spain, Sweden, Switzerland, Tahiti <b>9562CVR for</b> Austria, France, Germany, Netherlands, Poland, Reunion, Spain <b>9565C for</b> Austria, France, Germany, Italy, Netherlands, Poland, Reunion, Russia, Spain, Sweden, Switzerland, UK <b>9565CR for</b> Austria, France, Germany, Netherlands, Reunion, Russia, Spain, Switzerland <b>9565CV for</b> Austria, France, Germany, Italy, Netherlands, New Caledonia, Poland, Reunion, Russia, Spain, Sweden, Switzerland, Turkey, UK <b>9565CVR for</b> Austria, France, Germany, Italy, Netherlands, Poland, Reunion, Spain, Sweden, Switzerland, Turkey <b>9565H for</b> Austria, France, Germany, Italy, Netherlands, Poland, Reunion, Russia, Spain, Sweden, Switzerland, Tahiti, UK <b>Interchangeable as a set</b>
See Fig.2.	A02	Wheel Cover 165055-3		1	No	Wheel Cover 125K Assy 122887-1		1	The current remains available.
	A05	Pan Head Screw M5x16 251391-4		1	—	—		—	↑ <b>9565CLR for</b> Austria, France, Germany, Italy, Netherlands, Poland, Reunion, Spain <b>9565CVL for</b> Austria, France, Germany, Italy, Netherlands, Poland, Reunion, Russia, Spain, Sweden, Switzerland, UK <b>Interchangeable as a set</b>
	—	—		—	—	O Ring 4 213009-5		1	↑ Component of 165055-3/122887-1
	—	—		—	—	Pan Head Screw M5x16 265180-1		1	↓
	9565CLR: 053 9565CVL: 054	Bearing Box 318302-3		1	No	Bearing Box 318334-0		1	↓
See Fig.3.	048	Wheel Cover Ass'y 125268-8		1	No	Wheel Cover 125K Assy 122887-1		1	The current remains available.
	—	—		—	—	O Ring 4 213009-5		1	↑ Component of 125268-8/122887-1
	049	Pan Head Screw M5x14 265103-9		1	←	Pan Head Screw M5x16 265180-1		1	↓
	053	Bearing Box 318302-3		1	No	Bearing Box 318334-0		1	↓ <b>9565H for</b> Austria, France, Germany, Italy, Netherlands, Poland, Russia, Spain, Sweden, Switzerland, UK <b>Interchangeable as a set</b>

## Interchangeability mark;

The arrow ← means that the new part can be substituted for the current.

Interchangeability(I/C)

	Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
See Fig.4.	GA5010, GA5011, GA5020, GA5021: 051 9565C: 048	Wheel Cover Ass'y 135240-2		1	←	Wheel Cover 125K Assy 122887-1		1	<b>GA5010 for</b> Argentina, Australia, China, New Zealand, South Africa, Switzerland, Tahiti, Turkey, UK <b>GA5011 for</b> Australia, France, Italy, Netherlands, Reunion, South Africa, Spain, Switzerland, Turkey <b>GA5020 for</b> Argentina, Australia, Chile, France, Italy, Netherlands, New Caledonia, Reunion, Spain, Tahiti, Turkey, UK <b>GA5021 for</b> Austria, France, Germany, Italy, Netherlands, Poland, Reunion, South Africa, Spain, Switzerland, Turkey, UK <b>9565C for</b> China
	—	—				O Ring 4 213009-5		1	
See Fig.5.	GA5020C, GA5021C: 058 9565PC, 9565PCV: 039	Toolless Wheel Cover 125 Ass'y 135242-8		1	←	Toolless Wheel Cover 125 Ass'y 122895-2		1	<b>GA5020C for</b> Chile, Germany, Italy, Netherlands, Spain <b>GA5021C for</b> Argentina, Australia, Austria, Cyprus, France, Germany, Italy, Netherlands, New Caledonia, New Zealand, Poland, Reunion, Russia, South Africa, Spain, Sweden, Tahiti, Turkey, UK <b>9565PC for</b> Australia, Bhutan, Germany, Sweden <b>9565PCV for</b> Bhutan, France, Germany, Italy, Netherlands, Reunion, Spain, Sweden, UK
	—	—				O Ring 4 213009-5		1	
See Fig.6.	051	Wheel Cover 115K Assy 135202-0		1	No	Wheel Cover 125K Assy 122887-1		1	<b>GA5010 for</b> Brazil, Guam, Hong Kong, India, Kuwait, Philippines, Saudi Arabia, Singapore, Thailand, Vietnam <b>GA5011 for</b> Bhutan, Saudi Arabia <b>Interchangeable as a set</b>
	—	—				O Ring 4 213009-5		1	
	046	Bearing Box 318300-7		1	No	Bearing Box 318333-2		1	
See Fig.7.	051	Wheel Cover 115K Assy 135202-0		1	No	Wheel Cover 125K Assy 122887-1		1	<b>GA5020 for</b> Indonesia, Philippines, Taiwan, Thailand, Vietnam <b>GA5021 for</b> Bhutan <b>Interchangeable as a set</b>
	—	—				O Ring 4 213009-5		1	
	046	Bearing Box 318299-6		1	No	Bearing Box 318332-4		1	
See Fig.8.	040	Motor Housing 417812-8		1	←	Motor Housing 451779-0		1	<b>9562CH for</b> Austria, France, Germany, Italy, Netherlands, Poland, Reunion, Russia, Spain, Sweden, Switzerland, UK <b>9562CR for</b> Austria, France, Germany, Netherlands, Reunion, Spain <b>9562CVH for</b> Austria, France, Germany, Italy, Netherlands, New Caledonia, Poland, Reunion, Russia, Spain, Sweden, Switzerland, Tahiti <b>9562CVR for</b> Austria, France, Germany, Netherlands, Poland, Reunion, Spain <b>9565C for</b> Austria, France, Germany, Italy, Netherlands, Poland, Reunion, Russia, Spain, Sweden, Sweden, Switzerland, UK <b>9565CV for</b> Austria, France, Germany, Italy, Netherlands, New Caledonia, Poland, Reunion, Russia, Spain, Sweden, Sweden, Switzerland, Turkey, UK <b>9565CVL for</b> Austria, France, Germany, Italy, Netherlands, Poland, Reunion, Russia, Spain, Sweden, Switzerland, UK <b>9565CLR for</b> Austria, France, Germany, Italy, Netherlands, Poland, Reunion, Spain <b>9565CR for</b> Austria, France, Germany, Netherlands, Reunion, Russia, Spain, Switzerland <b>9565CVR for</b> Austria, France, Germany, Italy, Netherlands, Poland, Reunion, Spain, Sweden, Switzerland, Turkey <b>9565H for</b> Austria, France, Germany, Italy, Netherlands, Poland, Reunion, Russia, Spain, Sweden, Switzerland, Tahiti, UK
	9565C, 9565CV, 9565CVL: 033 9565CLR, 9565CR, 9565CVR, 9565H: 040	Motor Housing 418512-3		1	←	Motor Housing 451278-2		1	

Interchangeability mark;

The arrow ← means that the new part can be substituted for the current.

Implementation

From November 2009 production in MJ, MCC, MKC, MME and MMR plants