

TECHNICAL INFORMATION




65732

(Page 1 of 2)

- Subject** ► Change of Spindle
- For Models** ► 9560, 9560C, 9560CV, 9561, 9561C, 9561CV, 9562, 9562C, 9562CV, 9563, 9563C, 9563CV, 9564, 9564C, 9564CV, 9564CVL, 9565, 9565C, 9565CV, 9565CVL
- Country** ► All countries
- Description** ► See below.

End of Spindle has been changed in dimensions. Use an arbor press to insert a new Spindle into Gear Housing Complete as it is too tight to be inserted by hand. To distinguish the new Spindle from current one, a line has been added on it as shown below. Part No. remains the same.

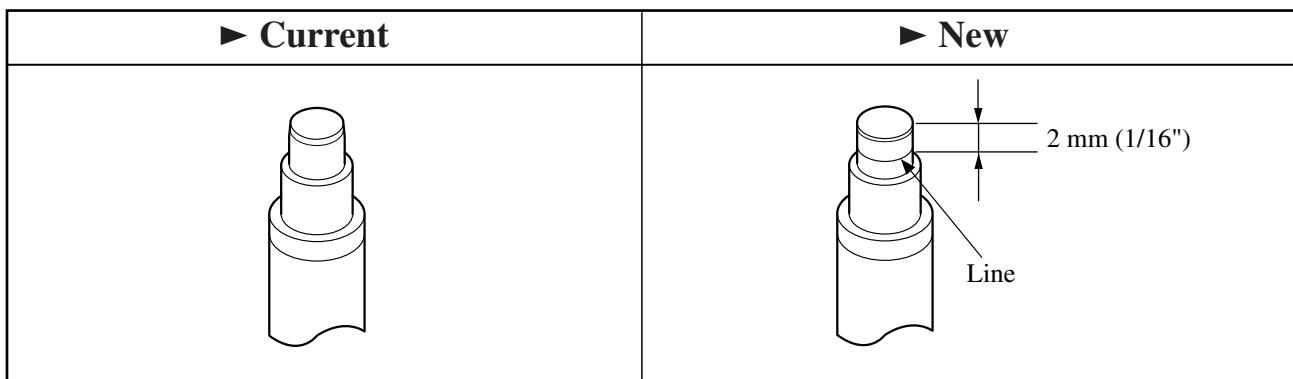


Note:

When removing or installing Gear Assembly (assembled part of Spiral Bevel Gear, O Ring, Bearing Box Complete, Wheel Cover Base, Hex. Socket Head Bolt, Labyrinth Ring and Spindle), do as follows.

<Removing>

If you have difficulty removing the Gear Assembly from machine body, use a plastic hammer to strike the shaded portion of the machine.


Strike this shaded portion with a plastic hammer.

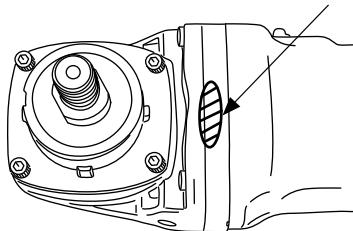

<Installing>

When installing the Gear Assembly on machine body, use a plastic hammer to strike the shaded portion of the machine.

Strike this shaded portion with a plastic hammer.

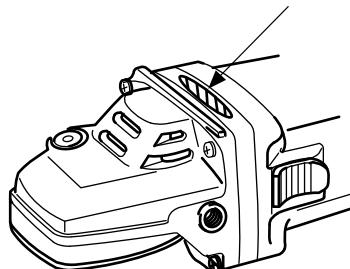

Interchangeability(I/C)

Item No.	Current part	Q'ty	I/C	New part	Q'ty	Note
050	Spindle 324035-0	1	Yes	Spindle 324035-0	1	See note 1 below.
050	Spindle 324036-8	1	Yes	Spindle 324036-8	1	See note 2 below.
050	Spindle 324038-4	1	Yes	Spindle 324038-4	1	See note 3 below.
050	Spindle 324043-1	1	Yes	Spindle 324043-1	1	See note 4 below.

Note

1. For 9561, 9561C, 9561CV, 9562, 9562C, 9562CV, 9564, 9564C, 9564CV, 9564CVL, 9565, 9565C, 9565CV, 9565CVL
For All countries except Canada, Mexico, U.S.A.
2. For 9560, 9560C, 9560CV, 9563, 9563C, 9563CV
For All countries except Guam, U.S.A.
3. For 9561, 9561C, 9561CV, 9562, 9564, 9564C, 9564CV, 9564CVL, 9565CV
For Canada, Mexico, U.S.A.
4. For 9560CV, 9563, 9563C, 9563CV
For Guam, U.S.A.

Implementation

9561CV: From serial No. 4162E (Mar., 2001)

9564CV: From serial No. 7653E (Mar., 2002)

All models other than 9561CV, 9564CV: To be informed later