

- Subject** ▶ Change of Switch
- For Models** ▶ JN3200, JR3000, JS3200, M101, M102, M361, M511, M515, M516, M801, M903, M992, N1900B, SR1600, SR1800, 1000SB, 1125, 1911B, 1923H, 2106, 3608B, 4100R, 4103KB, 4300SB, 4302C, 5600BR, 5600NB, 5800NB, 6013B, 63004, 6301, 6510B2, 8419B, 8419B2, 9030, 9900B, 9901, 9924B, 9924DB
- Country** ▶ See page 2.
- Description** ▶ Switch has been changed as shown below.
The new Switches don't come with four M3.5 Pan Head Screws.
Except for model N1900B, their wiring have been changed.


● **Change of Switch for Model N1900B**

	▶ Current	▶ New
Manufacturer	OMRON	FUJISOKU
Cat. No.	C2M-A1T	SGEL206C
Terminal Screw	(assembled with Switch)	Pan Head Screw M3.5 x 8
Part No.	651235-2	651232-8

● **Change of Switch for Models except N1900B**

	▶ Current	▶ New
Manufacturer	OMRON	FUJISOKU
Cat. No.	C2M-A1T	SGEL215C
Terminal Screw	(assembled with Switch)	Pan Head Screw M3.5 x 7
Part No.	651235-2	652008-6

● **Change of Wiring for Models except N1900B**

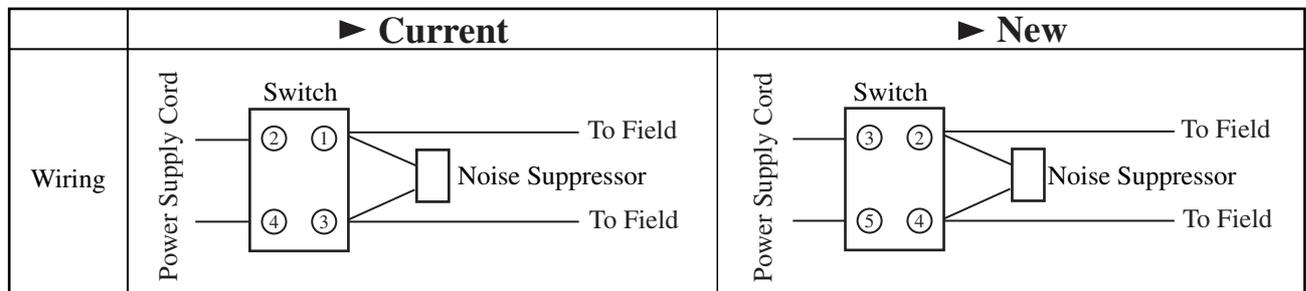

- **Noise Suppressor is not used in some countries and areas.**

Interchangeability(I/C)

For N1900B

Item No.	Current part	Q'ty	I/C	New part	Q'ty	Note
See next page.	Switch C2M-A1T 651235-2	1	→	Switch SGEL206C 651232-8	1	Interchangeable as a set
See next page.				Pan Head Screw M3.5x8 652037-9	4	

For Models except N1900B

Item No.	Current part	Q'ty	I/C	New part	Q'ty	Note
See next page.	Switch C2M-A1T 651235-2	1	→	Switch SGEL215C 651225-5	1	Interchangeable as a set
See next page.				Pan Head Screw M3.5x7 652008-6	4	

Interchangeability mark ;

The arrow → means that the current is substituted for the new part.

Interchangeability(I/C)

Item No. of **Switch**

Model	JN3200	JR3000	JS3200	M101	M102	M361	M511	M515	M516	M801	M903	M992	N1900B
Item No.	037	050	038	014	015	028	007	040	041	041	007	006	014

Model	SR1600	SR1800	1000SB	1125	1911B	1923H	2106	3608B	4100R	4103KB	4300SB	4302C	5600BR
Item No.	040	041	009	011	005	013	090	028	054	004	007	001	011

Model	5600NB	5800NB	6013B	63004	6301	6510B2	8419B	8419B2	9030	9900B	9901	9924B	9924DB
Item No.	007	013	031	047	032	039	042	041	056	026	006	016	009

Item No. of **Pan Head Screw**

Model	JN3200	JR3000	JS3200	M101	M102	M361	M511	M515	M516	M801	M903	M992	N1900B
Item No.	700	709	700	700	700	700	700	700	700	700	700	700	711

Model	SR1600	SR1800	1000SB	1125	1911B	1923H	2106	3608B	4100R	4103KB	4300SB	4302C	5600BR
Item No.	700	700	705	706	700	700	708	700	700	700	700	700	700

Model	5600NB	5800NB	6013B	63004	6301	6510B2	8419B	8419B2	9030	9900B	9901	9924B	9924DB
Item No.	700	700	706	700	700	700	700	700	700	700	700	708	700

Note

Applicable countries

	Model	Countries
Continued Models	JN3200	France, Germany, Italy, Netherlands, Spain, Sweden, U.K., Algeria, Reunion, South Africa, New Zealand, Tahiti
	JS3200	France, Germany, Italy, Netherlands, Russia, Spain, Sweden, U.K., Algeria, Cyprus, Kuwait, Reunion, Turkey, South Africa, New Caledonia, New Zealand, Tahiti
	N1900B	New Caledonia, Tahiti
	1911B	Tahiti
	1923H	Argentina, Tahiti
	2106	Austria, Germany, Spain, Sweden, Switzerland, Turkey, New Zealand
	5600NB	New Caledonia, Tahiti
	5800NB	New Caledonia, Tahiti
	6013B	Tahiti
	63004	Tahiti
	6301	Mexico
	8419B	U.K.
	8419B2	Italy, U.K., Australia, New Zealand, Tahiti
	9901	Austria, France, Germany, Italy, Netherlands, Russia, Spain, Sweden, U.K., Algeria, Reunion, Australia, New Caledonia, New Zealand
9924DB	Austria, France, Italy, Netherlands, Spain, Sweden, U.K., Algeria, Reunion, South Africa, Australia, New Caledonia, New Zealand, Tahiti	
Discontinued Models	JR3000, M101, M102, M361, M511, M515, M516, M801, M903, M992, SR1600, SR1800, 1000SB, 1125, 3608B, 4100R, 4103KB, 4300SB, 4302C, 5600BR, 6510B, 9030, 9924B	Countries where Switch (651235-2) has been used as replacement part.
	9900B	Switzerland, Tahiti

Implementation

JN3200: From October 2002 production
JR3000: Discontinued since April, 1997
JS3200: From October 2002 production
M101: Discontinued since April, 1992
M102: Discontinued since April, 1993
M361: Discontinued since April, 1993
M511: Discontinued since July, 1992
M515: Discontinued since August, 1991
M516: Discontinued since August, 1991
M801: Discontinued since April, 1992
M903: Discontinued since September, 1992
M992: Discontinued since April, 1993
N1900B: From October 2002 production
SR1600: Discontinued since April, 1995
SR1800: Discontinued since April, 1995
1000SB: Discontinued since April, 1989
1125: Discontinued since April, 1994
1911B: From October 2002 production
1923H: From October 2002 production
2106: From October 2002 production
3608B: Discontinued since April, 1993
4100R: Discontinued since April, 1993
4103KB: Discontinued since October, 1992
4300SB: Discontinued since October, 1991
4302C: Discontinued since September, 1995
5600BR: Discontinued since April, 1995
5600NB: From October 2002 production
5800NB: From October 2002 production
6013B: From October 2002 production
63004: From October 2002 production
6301: From October 2002 production
6510B2: Discontinued since April, 1993
8419B: From October 2002 production
8419B2: From October 2002 production
9030: Discontinued since April, 1996
9900B: Discontinued since May, 2001
9901: From October 2002 production
9924B: Discontinued since April, 1993
9924DB: From October 2002 production