
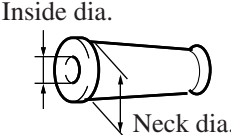
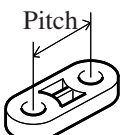
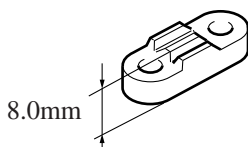
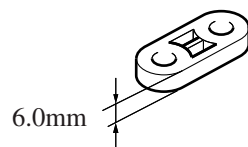
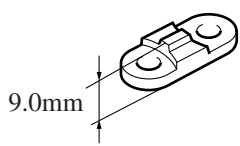
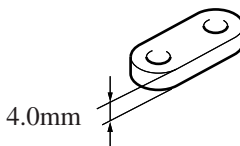
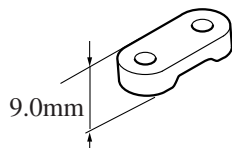
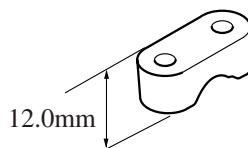


- Subject** ▶ Change of Power Supply Cord, etc.
- For Models** ▶ 1804K, 1804N, 2012, 2416S, 2708, 2711, 3600H, 3701,3702, 420S, 5103N, 5201N, 5500S, 6910, 906H, 9803, 9804, DA6300, HM1201, HM1302, HR3811
- Country** ▶ Germany, Sweden, Russia, South Korea
- Description** ▶ As described below, Power Supply Cord has been changed because the current Cord cannot be supplied by its manufacturer.  
Accordingly, Cord Guard and Strain Relief have been changed at the same time.

		► Current	► New	MODEL
Power supply cord		DRAKA (QR) 3 wires, outside dia.:ø9.3mm rubber, with molded plug	EN (H07RN-F) 3 wires, outside dia.:ø9.0mm rubber, with molded plug	All Models
Cord Guard  		Part No.682550-3 Inside dia : ø10mm Neck dia. : ø19mm	Part No.682540-6 Inside dia : ø9.3mm Neck dia. : ø19mm	1804N, 2708, 2711, 5103N, 5201N, 6910, HR3811
		Part No.682505-8 Inside dia : ø10mm Neck dia. : ø19mm		5500S, DA6300
		Part No.682504-0 Inside dia : ø10mm Neck dia. : ø17mm	Part No.682516-3 Inside dia : ø9.3mm Neck dia. : ø17mm	9804
Strain Relief  	Pitch 20mm	Part No.687052-4 	Part No.687053-2 	2708, 5103N ,5201N
	Pitch 15mm	Part No.687001-1 	Part No.687000-3 	1804N, 2416S, 2711, 6910, DA6300, HR3811
		Part No.687004-5 	Part No.687006-1 	5500S



## Change of Strain Relief

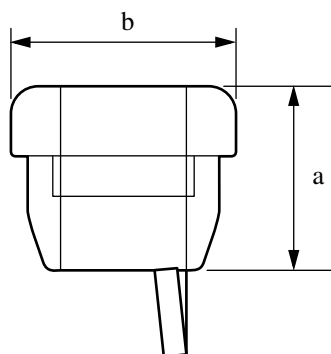

	CURRENT	NEW
Part No.	687008-7	687105-9
Length a	14.9 mm	19.1 mm
Length b	16.4 mm	19.8 mm
Indication Mark	KG,KR-61A	HEYCO,7P-2

## Change of Motor Rear Housing

(Encircled place, where Strain Relief is to be placed, have been modified.)

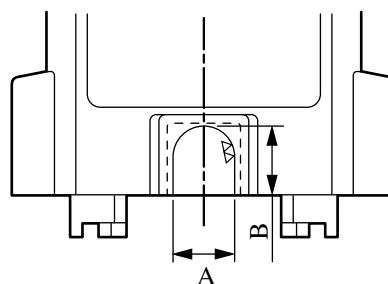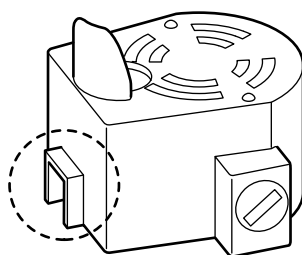

	CURRENT	NEW
Part No.	159325-0	151603-4
Length A	14.0 mm	16.5 mm
Length B	16.3 mm	16.7 mm

## Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
see the list below	Cord Guard 10 682550-3		1	No	Cord Guard 9.3-90 682540-6		1	1804N, 2708, 2711, 5103N, 5201N, 6910, HR3811
5500S:046 DA6300:024	Cord Guard 10-90 682505-8		1	No	Cord Guard 9.3-90 682540-6		1	5500S, DA6300
9804: 060	Cord Guard 10-85 682504-0		1	No	Cord Guard 9.3-85 682516-3		1	9804
2708: 074 5103N: 050 5201N: 022	Strain Relief 687052-4		1	No	Strain Relief 687053-2		1	2708, 5103N ,5201N
see the list below	Strain Relief 687001-1		1	No	Strain Relief 687000-3		1	1804N, 2416S, 2711, 6910, DA6300, HR3811
5500S: 045	Strain Relief 687004-5		1	No	Strain Relief 687006-1		1	5500S
3701: 001 3702: 002	Motor Rear Housing Complete 159325-0		1	No	Motor Rear Housing Complete 151603-4		1	↑ Interchangeable 3701, 3702 as a set ↓
3701: 024 3702: 900	Strain Relief 687008-7		1	No	Strain Relief 687105-9		1	

	Current	New	Item No.
Cord Guard	682550-3	682540-6	1804N: 012 , 2708: 077 , 2711: 113 , 5103N: 051 , 5201N: 021 , 6910: 044 , HR3811: 089
Strain Relief	687001-1	687000-3	1804N: 010 , 2416S: 058 , 2711: 112 , 6910: 046 , DA6300: 027 , HR3811: 091

## Implementation

1804K : Discontinued since Dec.,1985  
1804N : From your next order to be manufactured in/after June, 1999  
2012 : From your next order to be manufactured in/after June, 1999  
2416S : From serial No.86578E (Feb., 1999)  
2708 : From your next order to be manufactured in/after June, 1999  
2711 : From serial No.44999E (Jan., 1999)  
3600H : From serial No.72533E (Jan., 1999)  
3701 : From serial No.374314E (Feb., 1999)  
3702 : From your next order to be manufactured in/after June, 1999  
420S : From serial No.2825E (Jan., 1999)  
5103N : From your next order to be manufactured in/after June, 1999  
5201N : From your next order to be manufactured in/after June, 1999  
5500S : From your next order to be manufactured in/after June, 1999  
6910 : From your next order to be manufactured in/after June, 1999  
906H : From serial No.47513E (Jan., 1999)  
9803 : From your next order to be manufactured in/after June, 1999  
9804 : From your next order to be manufactured in/after June, 1999  
DA6300 : From serial No.28572E (Feb., 1999)  
HM1201 : From serial No.75764E (Jan., 1999)  
HM1302 : From serial No.22797E (Jan., 1999)  
HR3811 : From your next order to be manufactured in/after June, 1999