


T ECHNICAL INFORMATION

- Subject** ▶ 1) Change of Armature Assembly, Shoulder Sleeve 7, Flat Washer 6, Hex. Nut M6
2) Addition of Flat Washer 7
- For Models** ▶ HR3000C, HR3550C
- Country** ▶ All countries
- Description** ▶ The subject changes have been implemented as illustrated below.

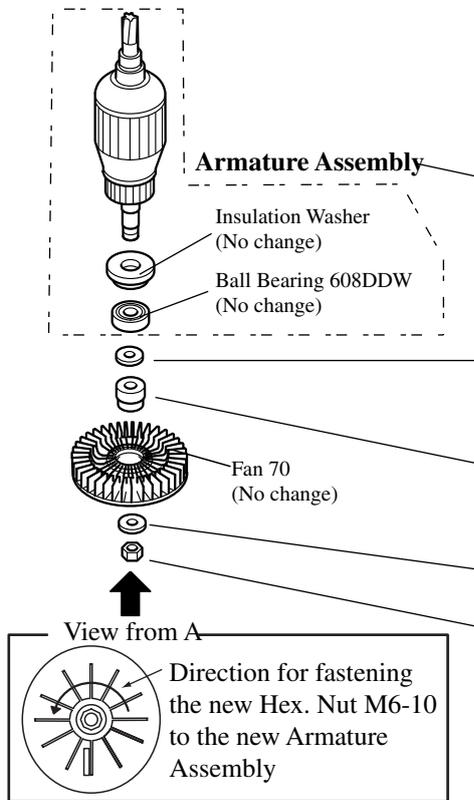

	▶ Current	▶ New
Change of the thread of Armature Shaft (A constituent part of Armature Assembly)	Right hand thread 516380-9 (for Taiwan) 516381-7 (for 115V countries) 516383-3 (for 220V-240V countries)	Left hand thread 513515-3 (for Taiwan) 513516-1 (for 115V countries) 513518-7 (for 220V-240V countries)
Addition of Flat Washer 7	N/A	253133-2
Change of Shoulder Sleeve 7: See note below.	14mm (9/16") (323937-7)	13mm (1/2") (324261-1)
Change of Flat Washer 6	253047-5	941151-9
Change of Hex. Nut M6	Right hand thread (931302-2)	Left hand thread (252153-3)

Interchangeability(I/C)

Item No.	Current part	Q'ty	I/C	New part	Q'ty	Note
134	Flat Washer 7			Flat Washer 7 253133-2	1	Interchangeable as a set
124	Shoulder Sleeve 7 323937-7	1	No	Shoulder Sleeve 7 324261-1	1	
126	Flat Washer 6 253047-5	1	←	Flat Washer 6 941151-9	1	
127	Hex. Nut M6 931302-2	1	No	Hex. Nut M6-10 252153-3	1	
114	Armature Assembly 100V 516380-9	1	No	Armature Assembly 100V 513515-3	1	Taiwan only
114	Armature Assembly 115V 516381-7	1	No	Armature Assembly 115V 513516-1	1	Interchangeable as a set including Hex. Nut M6-10
114	Armature Assembly 220V-240V 516383-3	1	No	Armature Assembly 220V-240V 513518-7	1	

Interchangeability mark ;

The arrow ← means that the new part is substituted for the current.

Note

When replacing Shoulder Sleeve 7, also replace Fan 70 at the same time.

Implementation

To be informed later