


Subject ▶ Changes on side handle and carrying case

For Models ▶ HR5000,HR5000K(50mm Rotary Hammers)

Note ▶ This information applies to
HR5000 All Countries
HR5000K All Countries except United Kingdom

Description ▶ As in illustrated below, side handle has been changed for lower cost.

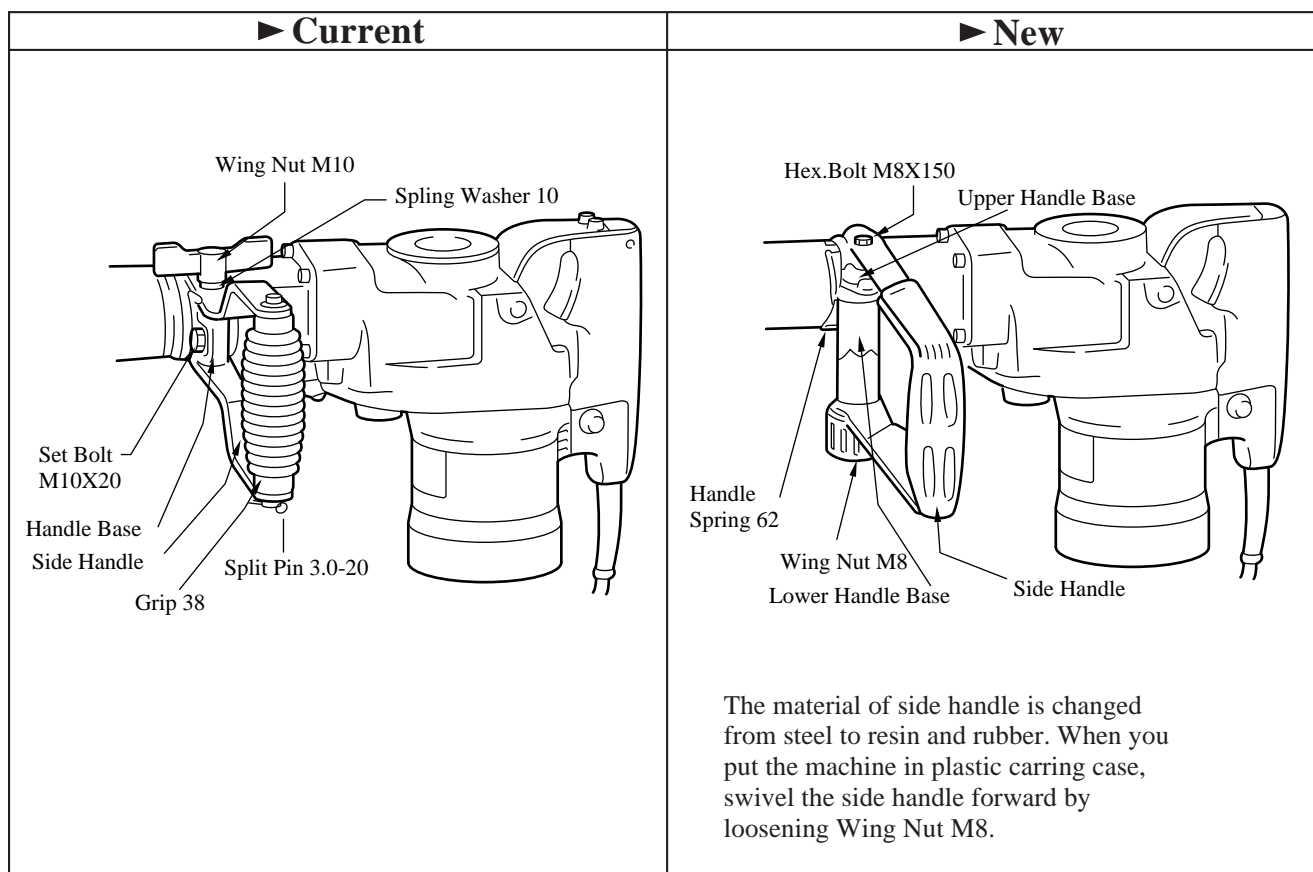

Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	
88	Side Handle 343519-9		1	No	Side Handle 416061-4		1	<div> <div>↑</div> <div>The current remains available for replacement.</div> <div>↓</div> <div>Interchangeable as a set</div> <div>↑</div> </div>
	Grip 38 273492-8		1					
	Split Pin 3.0-20 952257-8		2					
89	Wing Nut M10 259020-3		1	No	Wing Nut M8 252640-2		1	
91	Set Bolt M10X20 265902-9		1	No	Hex Bolt M8X150 265439-6		1	
120	Handle Base 414774-1		1	No	Upper Handle Base 416060-6		1	
121					Lower Handle Base 416089-2		1	
	Spring Washer 10 942251-8		1					
400	Steel Carrying Case 182703-9		1	No	Plastic Carrying Case Complete 150589-9		1	HR5000 U.K.,France,Germany, Netherlands,Spain, Italy,Reunion,Algeria, Austria,Sweden, Norway,Finland, Switzerland,U.S.A.,Guam and Canada
400	Steel Carrying Case 182701-3		1	No	Plastic Carrying Case Complete 150582-3		1	HR5000K

Note

Correction of I/C(Interchangeability) in TEC-126/95(R) and TEC-127/95(R):

I/C was "Yes" in the Technical Informations.

However, it is now "No" as the side handle has been changed as described above.

Implementation

HR5000 : From serial No.31817E

HR5000K : From serial No.39379E