


- Subject** ▶ Changes on Handle Spring 62, Upper Handle Base and Lower Handle Base
- For Models** ▶ HR5000, HR5000K (50mm Rotary Hammers)
- Description** ▶ As illustrated below, three parts have been changed to improve endurance of Handle Spring 62.

	▶ Current	▶ New
Upper Handle Base	Corner contacted with Handle Spring 62 : R5	Corner contacted with Handle Spring 62 : R8
Lower Handle Base		
Handle Spring 62	Corner contacted with handle bases : R5	Corner contacted with handle bases : R8
	Thickness : 1.0mm	Thickness : 1.2mm

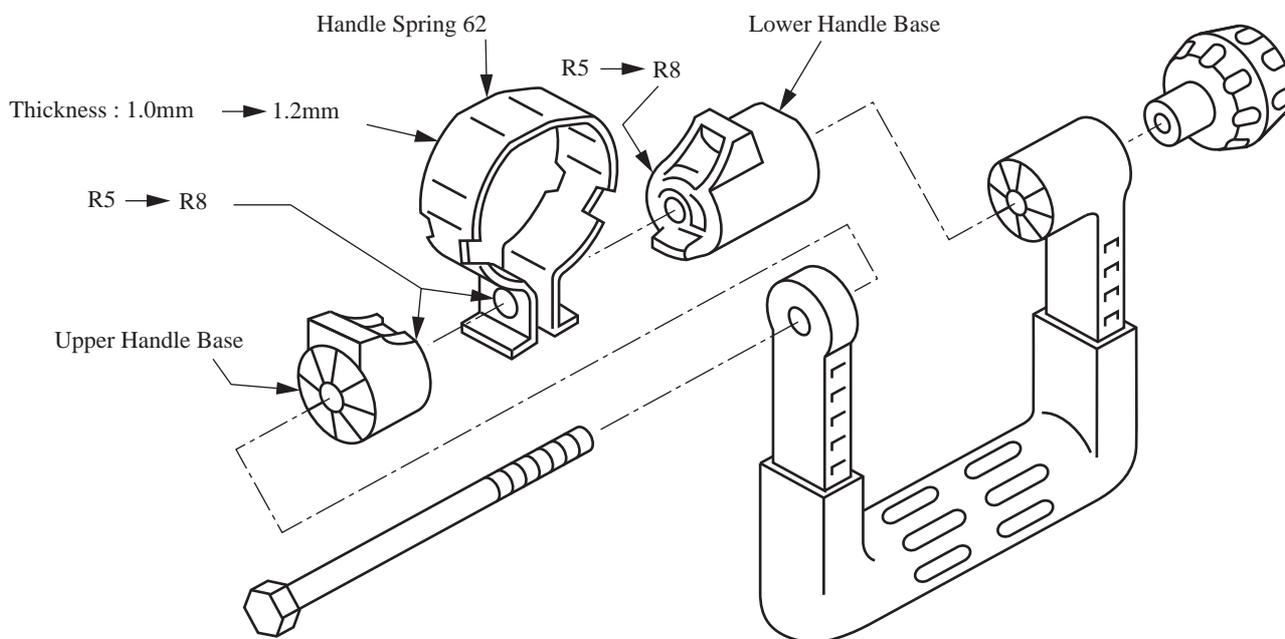

Interchangeability(I/C)

Item No.	Current part	Q'ty	I/C	New part	Q'ty	Note
122	Handle Spring 62 344387-3	1	No	Handle Spring 62 344617-2	1	Interchangeable as a set
120	Upper Handle Base 416060-6	1	No	Upper Handle Base 416480-4	1	
121	Lower Handle Base 416089-2	1	No	Lower Handle Base 416481-2	1	

Implementation

- HR5000 : From serial No.40091E(June,1997)
- HR5000K : From serial No.44930E(June,1997)