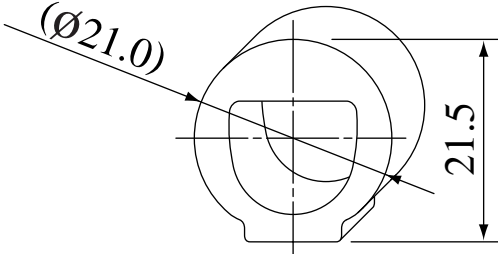
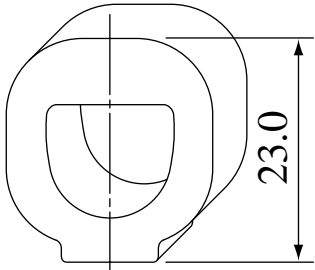
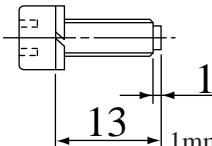
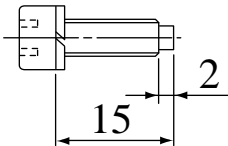
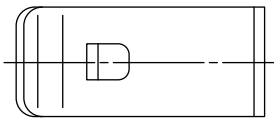
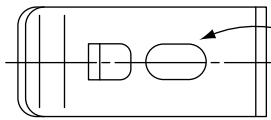


- Subject** ▶ Changes on blade clamp, hex socket head bolt and leaf spring
- For Models** ▶ JR3020, JR3000V and JR3000 (Recipro Saws)
- Description** ▶ As described below, three parts have been changed for easier saw blade fixing.

	► Current	► New
Blade Clamp		
Hex Socket Head Bolt to fix blade clamp	 M5x13 1mm protrusion which prevents blade from falling out	 M5x15 Protrusion is prolonged to 2mm.
Leaf Spring (JR3020 only)		 Hole for the hex bolt's protrusion to go through

## Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
10	Blade Clamp 313067-2		1	No	Blade Clamp 313075-3		1	Interchangeable as a set JR3020
11	Hex Socket Head Bolt M5X13 265986-7		1	No	Hex Socket Head Bolt M5X15 266090-5		1	
9	Leaf Spring 232129-6		1	<=	Leaf Spring 232165-2		1	
32	Blade Clamp 313067-2		1	No	Blade Clamp 313075-3		1	Interchangeable as a set JR3000V, JR3000
70	Hex Socket Head Bolt M5X13 265986-7		1	No	Hex Socket Head Bolt M5X15 266090-5		1	

## Implementation

JR 3020 : From serial No 17196E  
JR 3000V : From serial No 1613031E  
JR 3000 : From serial No 265822E