

TECHNICAL INFORMATION



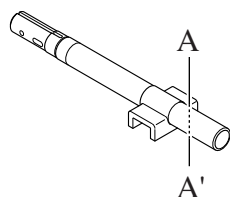
73348
June, 2005

Subject ▶ Change of Slider and M5x10 Pan Head Screws



For Models ▶ JR3050T, JR3060T, JR3070CT



Country ▶ All countries

Description ▶ Caulking material of Slider has been replaced by Cap.
Regarding JR3050T, three M5x10 Pan Head Screws for bearing retainer have been replaced by three M5x8 Hex. socket head bolts.
See illustration below.



Cross section of Slider/Slider complete

▶ Current	▶ New
 (Caulking material) Slider (For JR3050T: 168405-1) (For JR3060T, JR3070CT: 168410-8)	 (Cap) Slider complete (For JR3050T: 154788-5) (For JR3060T, JR3070CT: 154804-3)

▶ Current	▶ New
 M5x10 Pan Head Screw for JR3050T's bearing retainer (911606-8)	 Hex. Socket Head Bolt M5x8 for JR3050T's bearing retainer (265530-0)

Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
029	Slider 168405-1		1	Yes	Slider Complete 154788-5		1	JR3050T
024	Slider 168410-8		1	Yes	Slider Complete 154804-3		1	JR3060T, JR3070CT
046	Pan Head Screw M5x10 911606-8		3	Yes	Hex. Socket Head Bolt M5x8 265530-0		3	JR3050T

Implementation

Immediately upon completion of preparation after May 2005.