

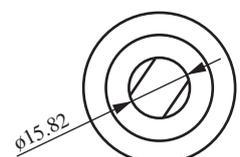
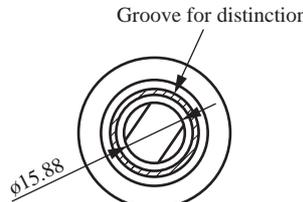


Subject ▶ Change on spindle and flange.

For Models ▶ 5007NB, 5007NBA, (manufactured in U.S.A.)
5007S, 5008NB, 5008NBA, 5008B, 5007B, M513, M514, SR2100, SR2300, SR2600
(manufactured in Japan)

Description ▶ As illustrated below, dimensions of spindle and inner flange have been changed for standardization.

	▶ Current	▶ New
Spindle		
Inner flange		

Interchangeability(I/C)

Item No	Current part	Q'ty	I/C	New part	Q'ty	Note
5	Spindle 321060-2	1	Yes	Spindle 323789-6	1	5007NB,5007NBA,5007S, 5007B,M513,M514 5008NB,5008NBA (U.S.A.,Canada)
5	Spindle 321060-2	1	=>	Spindle 323789-6	1	5008B,SR2100 5008NB,5008NBA (Except U.S.A.,Canada)
3	Inner Flange 40 224223-8	1	<=	Inner Flangee 40 224360-8	1	5008B,SR2100 5008NB,5008NBA (Except U.S.A.,Canada)
21	Inner Flange 40 224223-8	1	Yes	Inner Flange 40 224360-8	1	SR2300,SR2600

Note

Interchangeability mark: <= means that the new part can be substituted for the current.
=> means that the current part can be substituted for the new.

Implementation

5007NB : From Dec.,1997 (manufactured in U.S.A.)
5007NBA : From Dec.,1997 (manufactured in U.S.A.)
5007S : From your next order
5008NB : From your next order
5008NBA : From your next order
5008B : From serial No.108063E (May, 1998)

5007B : Discontinued since Oct., 1993
M513 : Discontinued since June, 1991
M514 : Discontinued since June, 1991
SR2100 : Discontinued since Apr., 1995
SR2300 : Discontinued since Apr., 1995
SR2600 : Discontinued since Apr., 1996