


- Subject** ▶ Change on helical gear 52 and addition of urethane sleeve 4
- For Models** ▶ UH3000D/DW, M013, UH3070D/DW, UH301D/DW, M016/W (Cordless Hedge Trimmer) and UH302D/DW (Battery-Powered Hedge Trimmer)
- Description** ▶ The two holes in the helical gear 52 will be enlarged and two urethane sleeves will be inserted into these holes. These urethane sleeves will serve as shock absorbers to protect the helical gear 52 and gear 14-34 from shock.

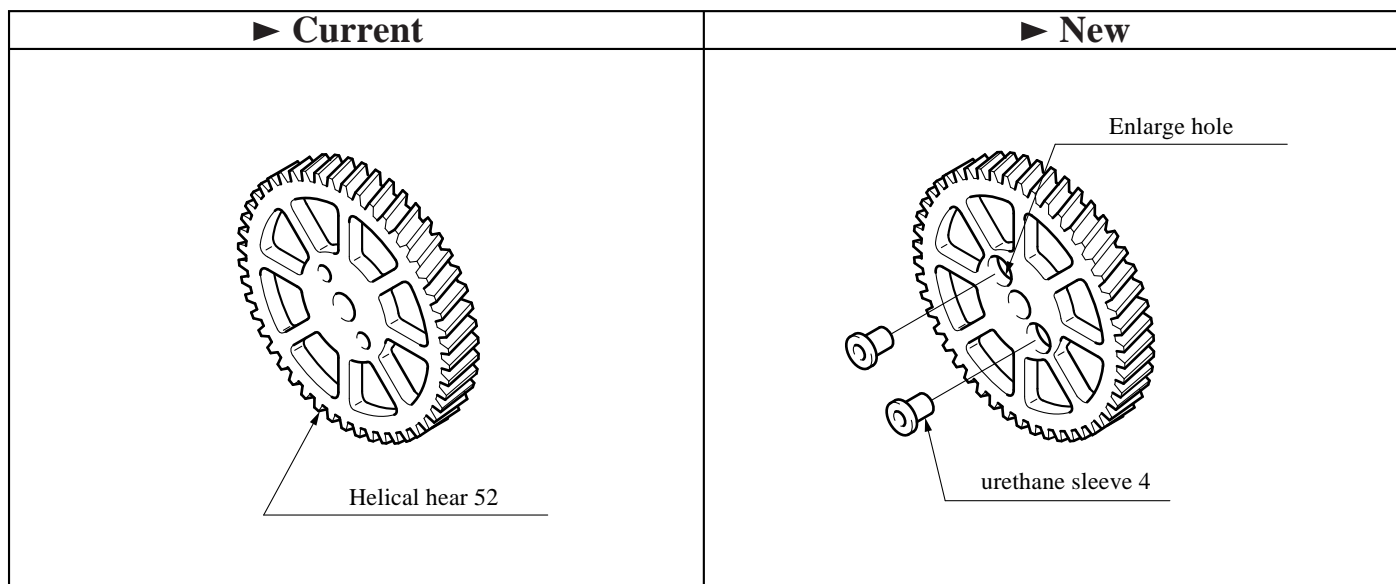

## Interchangeability(I/C)

Item No.	Current part	Q'ty	I/C	New part	Q'ty	Note
11	Helical gear 52 221736-0	1	No	Helical gear 52 226437-5	1	For UH3000D/DW, M013, UH3070D/DW Interchangeable as a set
22				Urethane sleeve 4 262531-9	2	
10	Helical gear 52 221771-8	1	No	Helical gear 52 226436-7	1	For UH301D/DW, M016/W, UH302D/DW Interchangeable as a set
28				Urethane sleeve 4 262531-9	2	

## Note

When replacing the gear 14-34, also replace the current type helical gear by the new type helical gear and the urethane sleeves.

## Implementation

UH3000D : From serial No. 537464E

UH3000DW: From the next order

M013, UH3070D/DW, UH301D/DW, M016/W, UH302D/DW: Discontinued