


TECHNICAL INFORMATION



64747

- Subject** ▶ Change of Spindle and Addition of Retaining Ring S-15
- For Models** ▶ 5007NB, 5007NBA, 5007NH, 5007NL, 5007S, 5007F, 5007FA, 5057KB, 4157KB
- Country** ▶ All countries
- Description** ▶ Retaining Ring S-15 has been added. Accordingly, a groove for installing this Retaining Ring has been added on Spindle.

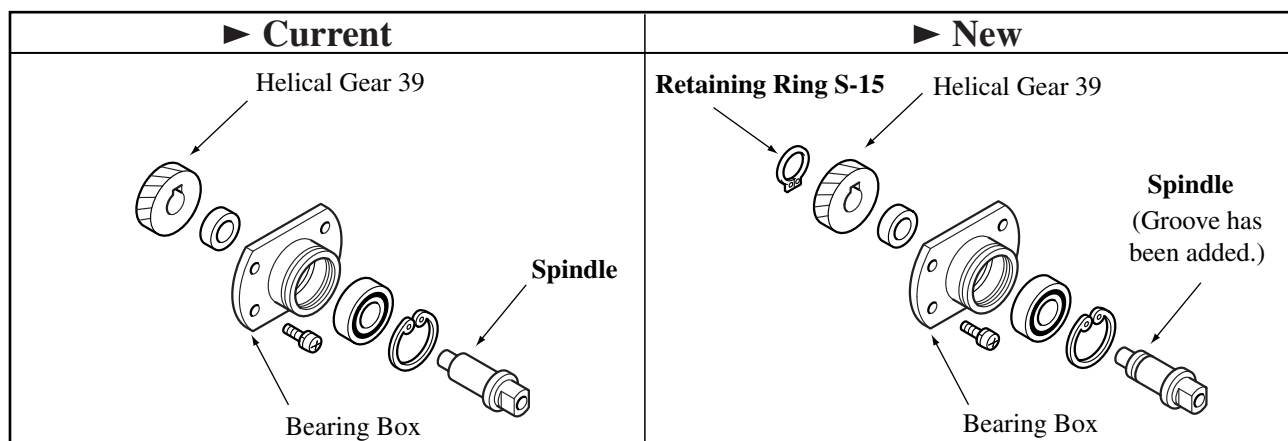

Interchangeability(I/C)

● For Models 5007NB, 5007NBA, 5007NH, 5007F, 5007FA, 5007S

Item No.	Current part	Q'ty	I/C	New part	Q'ty	Note
See below	Spindle 324044-9	1	No	Spindle 324256-4	1	
See below				Retaining Ring S-15 961055-9	1	

Item No. for Spindle (324256-4)

Model	5007NB	5007NBA	5007NH	5007F	5007FA	5007S
Item No.	028	028	011	028	028	027

Item No. for Retaining Ring S-15 (961055-9)

Model	5007NB	5007NBA	5007NH	5007F	5007FA	5007S
Item No.	028	028	011	028	028	027

● For Model 4157KB

Item No.	Current part	Q'ty	I/C	New part	Q'ty	Note
041	Spindle 324044-9	1	No	Spindle 324257-2	1	
089				Retaining Ring S-15 961055-9	1	

● For Model 5007NL

Item No.	Current part	Q'ty	I/C	New part	Q'ty	Note
011	Spindle 324045-7	1	No	Spindle 324258-0	1	
089				Retaining Ring S-15 961055-9	1	

● For Model 5057KB

Item No.	Current part	Q'ty	I/C	New part	Q'ty	Note
041	Spindle 324133-0	1	No	Spindle 324257-2	1	
036				Retaining Ring S-15 961055-9	1	

Implementation

5007NB: From serial No. 1383260E (Oct., 2001)

The remaining Models: To be informed later.