


# TECHNICAL INFORMATION



63333

Subject	► Change of Roller and Pin 4 (the components of Retainer Complete)
For Models	► 4304, 4304T, 4304Z, 4305, 4305T, 4306, 4330D, 4331D, 4332D, 4333D, 4334D, DK1032
Country	► All countries
Description	► To increase the durability of Roller against abrasion, Roller and Pin 4 have been changed as illustrated below. Consequently the part number of Retainer Complete has been changed.

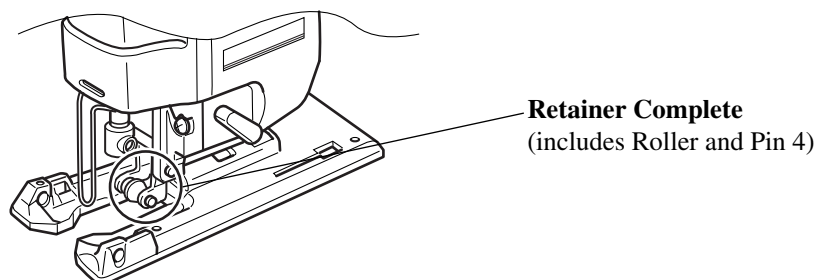

	► Current	► New
Roller / Roller Complete	 4mm Roller (322709-7)	 3.969mm Roller Needle Bearing 406 is in the Roller. Roller Complete (152950-6)
Pin 4	 4mm (256667-4)	 3.969mm (268074-9)
Retainer Complete	 Roller Pin 4 (151426-0)	 Roller Complete Pin 4 (152947-5)

## Interchangeability(I/C)

Item No.	Current part	Q'ty	I/C	New part	Q'ty	Note
	Roller 322709-7	1	No	Roller Complete 152950-6	1	Interchangeable as a set
	Pin 4 256667-4	1	←	Pin 4 268074-9	1	
See below.	Retainer Complete 151426-0	1	←	Retainer Complete 152947-5	1	Includes Roller Complete and Pin 4.

4304 : 053  
 4304T, 4334D : 040  
 4304Z : 017  
 4305 : 039  
 4305T : 021  
 4306 : 016  
 4331D, 4332D, 4334D, 4334D : 020

## Note

- 1) Interchangeability mark ; ← means that the new part is substituted for the current.
- 2) The current Pin 4 can be used as a replacement part for 4301V, 4301BV.

## Implementation

Around May, 2001  
 Serial No. will be informed later.