


Subject ▶ Change on switch

For Models ▶ DA3000D/DW, DA390D/DW (Cordless Angle Drill), 6010D/DW/DWK, M002/W, 6012D/DW/DWK (Cordless Drill), 6012HD/HDW (Cordless Driver Drill), 6710D/DW (cordless Screwdriver), 8400D/DW (Cordless Hammer Drill), 6010DL, 6012DL, 6012HDL (Cordless Drill kit Deluxe), DK1001, DK1201 (Cordless Drill Kit II), and DK1002 (Cordless Drill Kit Deluxe II)

Description ▶ The new type switch will have a reinforced plunger and flexible lever. To differentiate the new type switch from the current one, the color of the label on the switch will be changed from yellow to white.

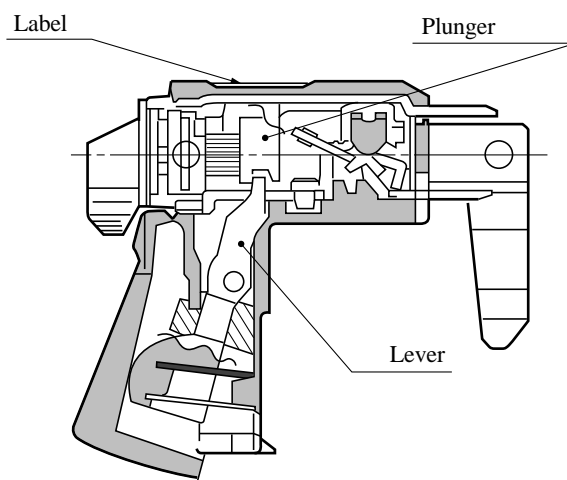

Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
9	Switch assembly 531043-6		1	Yes	Switch assembly 531043-6		1	For all the above tools except 8400D/DW
17	Switch assembly 531044-4		1	Yes	Switch assembly 531044-4		1	For 8400D/DW

Implementation

6010D : From serial No. 649342E

6010DL : From serial No. 2479238E

6010DW : From serial No. 4949915E

6012DL : From serial No. 1200640E

6012DW : From serial No. 4633428E

6012HDL: From serial No. 3053039E

6012HDW: From serial No. 3566067E

6012D, 6012HD, 8400D, 8400DW and DK1001:

* For Canada: From the next order

* For all countries and areas except Canada: As soon as the current type switch runs out of our stock

DA3000D/DW, DA390D/DW, 6710D/DW, DK1002 and DK1201: Discontinued