


**Subject** ▶ Change on gear housing and discontinuance of tool rest

**For Models** ▶ 9005B, 9006B, 9005BS (Disc Grinder) and PC1100 (Concrete Planer)

**Description** ▶ 1. The tool rest will be moulded onto the gear housing.

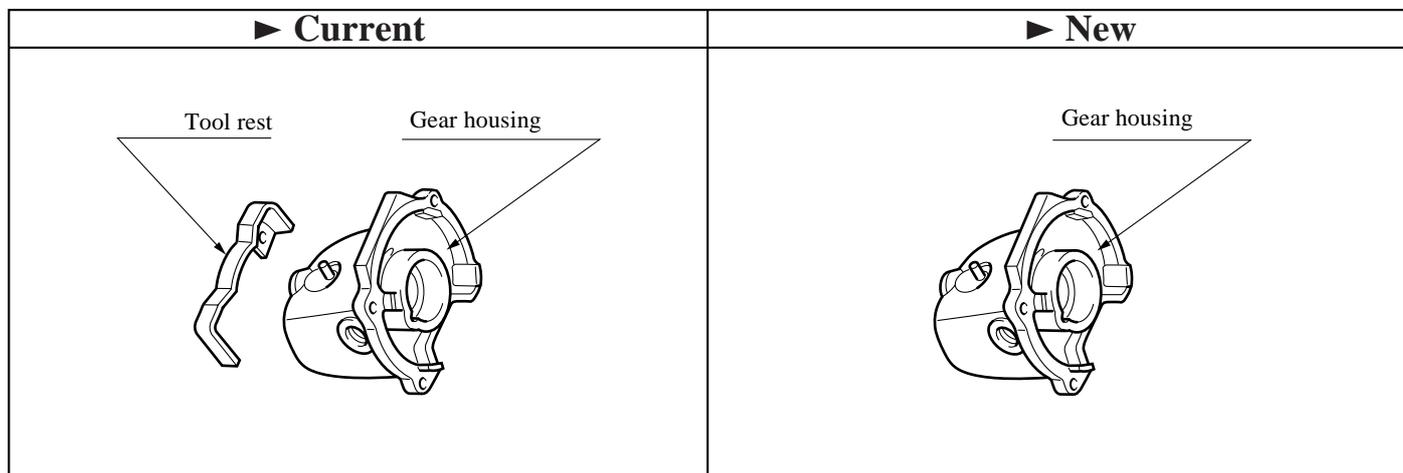

2. The screws which secure the bearing box to the gear housing will be changed as follows.

For Models	Current	New
9005B, 9006B, and 9005BS	Pan head screw M4x14	Tapping screw CT4x16
PC1000	Pan head screw M4x22	Tapping screw CT4x25

### Interchangeability(I/C)

Item No.	Current part	Q'ty	I/C	New part	Q'ty	
3	Gear housing 156735-2	1	No	Gear housing 159710-7	1	Interchangeable as a set
2	Tool rest 341680-6	1				
31	Pan head screw M4x14 911121-2	4	Yes	Tapping screw CT4x16 266034-5	4	For 9005B, 9006B and 9005BS
29	Pan head screw M4x22 911141-6	4	Yes	Tapping screw CT4x25 266040-0	4	For PC1100

### Note

- The new type gear housing for replacement has tapped holes in it. So either pan head screw or tapping screw can be used to secure the bearing box to the gear housing.
- The tool rest (Pt. No. 341680-6) has been employed in Models 9005B, 9006B and 9005BS but has not not been employed in Model PC1100.

### Implementation

9005B : From serial No. 921950E  
 9005BS: From serial No. 2101E  
 9006B : From serial No. 65555E  
 PC1100: From serial No. 22566E