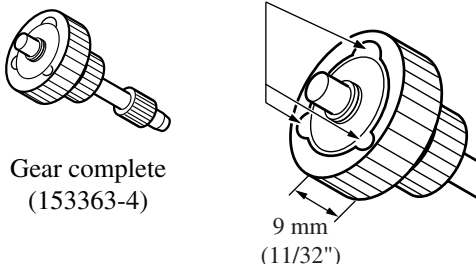
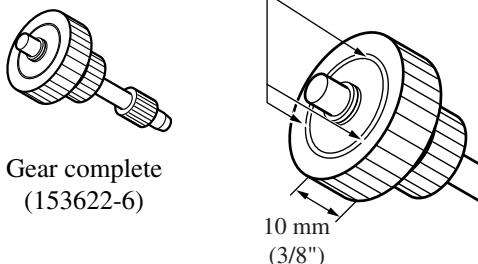
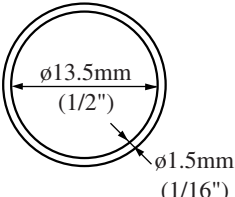
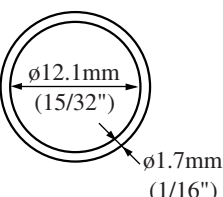



- Subject** ▶ Change of Gear Complete and O Ring,
Reduction of Makita Grease
- For Models** ▶ HP2050, HP2050F, HP2051, HP2051F
- Country** ▶ All countries
- Description** ▶ Gear complete and O ring have been changed as illustrated below.
At the same time, the amount of Makita Grease in Gear housing complete has been reduced.

Change of Gear Complete

▶ Current	▶ New
<p>Hollows at each point along the circle.</p>  <p>Gear complete (153363-4)</p> <p>9 mm (11/32")</p>	<p>No hollow</p>  <p>Gear complete (153622-6)</p> <p>10 mm (3/8")</p>

Change of O Ring for Change Lever B

▶ Current	▶ New
 <p>O Ring 14 (213162-7)</p>	 <p>O Ring 12 (213122-9)</p>

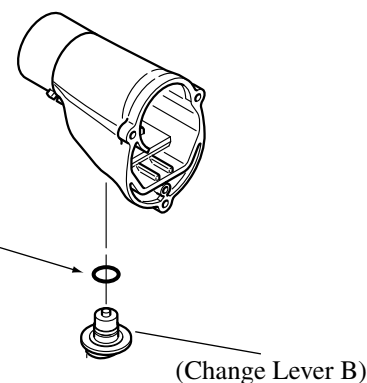

Reduction of Makita Grease in Gear Housing Complete

	▶ Current	▶ New
Required quantity	38.5 g	30 g

Interchangeability(I/C)

Item No.	Current part		Q'ty	I/C	New part		Q'ty	Note
021	Gear Complete 153363-4		1	Yes	Gear Complete 153622-6		1	
025	O Ring 14 213162-7		1	Yes	O Ring 12 213122-9		1	
—	Makita Grease N No.1 (2.5 kg) 042017-7A		38.5g	←	Makita Grease N No.1 (2.5 kg) 042017-7A		30g	

Interchangeability mark ;

The arrow ← means that the new part can be substituted for the current.

Implementation

To be implemented from Nov., 2003