


Subject ▶ Change of Inner flanges 62
Elimination of Rings

For Models ▶ LS1216, LS1216F, LS1216FL, LS1216L


Country ▶ See below.

Description ▶ Inner flanges 62 have been modified to reduce the slight wobble of blade.

①, ② Change of Inner flange 62 and elimination of Ring 15.8

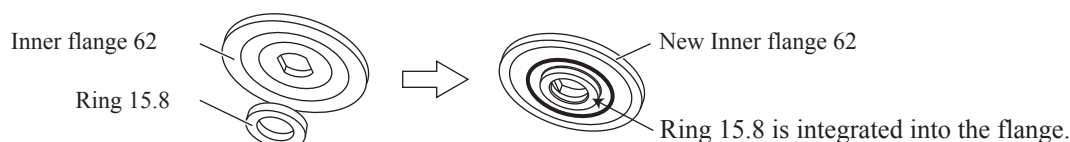

③, ④ Change of Inner flange 62 and elimination of Ring 16

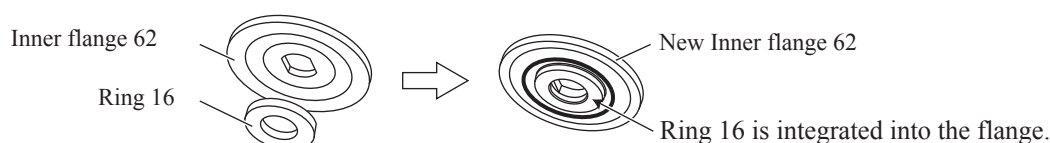

⑤, ⑥ Elimination of Ring 15.8 and Addition of Inner flange 62 from/to Standard accessories.

	Model	Country	Implementation
①	LS1216	China	After the current parts in stock are cleared.
②			At the same time with ①
③	LS1216	Argentina, Austria, Commonwealth of Dominica, Cyprus, France, Italy, Netherlands, New Caledonia, Poland, Reunion, Russia, Spain, Sweden, Turkey, UK	After the current parts in stock are cleared.
	LS1216F	France, Germany, Italy, Netherlands, Reunion, Spain	
	LS1216FL	France, Spain	
	LS1216L	Argentina, Austria, Cyprus, Germany, Netherlands, New Caledonia, Poland, South Africa, Spain, Sweden, Switzerland, Tahiti, Turkey, UK	
④	LS1216	Argentina, Austria, Commonwealth of Dominica, Cyprus, France, Italy, Netherlands, New Caledonia, Poland, Reunion, Russia, Spain, Sweden, Turkey, UK	At the same time with ③
	LS1216F	France, Germany, Italy, Netherlands, Reunion, Spain	
	LS1216FL	France, Spain	
	LS1216L	Argentina, Austria, Cyprus, Germany, Netherlands, New Caledonia, Poland, South Africa, Spain, Sweden, Switzerland, Tahiti, Turkey, UK	
⑤	LS1216	Argentina, Commonwealth of Dominica	At the same time with ③
⑥	LS1216L	Argentina	

Interchangeability(I/C)

	Item No.	Current part	Q'ty	I/C	New part	Q'ty	Note
①	093	Inner flange 62 224434-5	1	No	Inner flange 62 224463-8	1	Interchangeable as a set
②	E01	Ring 15.8 257060-5	1				
③	093	Inner flange 62 224434-5	1	No	Inner flange 62 224464-6	1	Interchangeable as a set
④	E01	Ring 16 257262-3	1				
⑤	See the right	Ring 15.8 257060-5	1				A08: LS1216 A09: LS1216L
⑥	See the right				Inner flange 62 224463-8	1	A09: LS1216 A10: LS1216L